

B6 782 42 52 (or later). Reference the applicable WIS documents listed below and adjust the Aux output volume level after replacement per the below procedure.

**Note** : If the vehicle is equipped with the latest iPod interface Module, you can use the procedure to adjust the Aux volume output

#### Instructions to Remove the Head Unit and iPod Interface Module

Model 171: Refer to the corresponding sections of WIS document AZ82.60-P-0014VA

Model 203: Removal of Audio 20 Head Unit, refer to WIS document AR82.60-P-7502PA

Removal of COMAND MCSII Head Unit, refer to WIS document AR82.85-P-7472PA

Removal of iPod Interface Module, refer to WIS document  
AZ82.60-P-0001-03QA

Model 209: Removal of Audio 20 Head Unit, refer to WIS document  
AR82.60-P-7502QA

Removal of COMAND MCSII Head Unit, refer to WIS document AR82.85-P-7472Q

Removal of iPod Interface Module, refer to WIS document AZ82.60-P-0001-03QA

Model 211: Refer to the corresponding sections of WIS documents AZ82.60-P-0014TT for S211 and AZ82.60-P-0014T for W211.

Model 219: Refer to the corresponding sections of WIS document AZ82.60-P-0014TX

#### Step 2 - Adjust the Aux Output Volume Level

^ Use the MFS buttons to select the iPod menu (Aux) in the instrument cluster (IC)

^ Simultaneously, hold down the down-arrow + Tel hang-up MFS buttons for about 8 seconds, the IC displays the words "DIAG" on the top and "SW.." on the bottom --> wait 5 seconds, the IC displays "DIAG" , "HW.." --> wait another 5 seconds --> "DIAG", "Vol..."

^ Within 5 seconds of the "DIAG", "Vol" display appearing, you can press the up or down arrow to adjust the Aux output volume. Make sure it is set to the loudest --> wait 5 seconds without pressing any MFS buttons --> the display will return to iPod main screen automatically.