


AF54.21-P-2003P	Taillamps come on when ignition is switched on	18.11.02
-----------------	--	----------

MODEL 203


Operation no. of operation texts or standard texts and flat rates

Category	Op. no.	Operation text	Time	Acc. no.	Code
P	023770	Reset rear SAM control unit with fuse and relay box	13 WU/1.1 h	---	---
P	023772	Replace rear SAM control unit with fuse and relay box (after checking), model 203.0	12 WU/1.0 h	---	---
P	023772	Replace rear SAM control unit with fuse and relay box (after checking), model 203.2	9 WU/0.8 h	---	---
P	023772	Replace rear SAM control unit with fuse and relay box (after checking), model 203.7	10 WU/0.8 h	---	---

Damage code	Cause	Remedy	
54 590	Malfunction in signal acquisition and actuation module (SAM) with fuse and relay box.	Reset rear SAM control module with fuse and relay box (N10/2), see Steps 1-5	
		1 Perform short test, read out DTC memory.	
			AD00.00-P-2000-04A
		2 Remove dust filter housing.	
			AP83.00-P-8381P
		3 Disconnect ground line (1) from ground connection on battery (W10) and leave disconnected for 15 min.	
		4 Connect ground line (1) to battery ground point (W10).	
		5 Check parking lamps for proper operation.	
		 Problem eliminated: Perform	

		Steps 6-8	
		i Problem not eliminated: Perform Step 9.	
		6 Install dust filter housing.	
			AP83.00-P-8381P
		7 Perform short test, read out DTC memory.	
			AD00.00-P-2000-04A
		8 Perform basic programming	AR00.19-P-0200P
		9 Remove and replace rear SAM control module (N10/2).	
		Model 203.0	AR54.21-P-1259P
		Model 203.2	AR54.21-P-1259PC
		Model 203.7	AR54.21-P-1259PS

1 Ground cable
W10 Ground (battery)

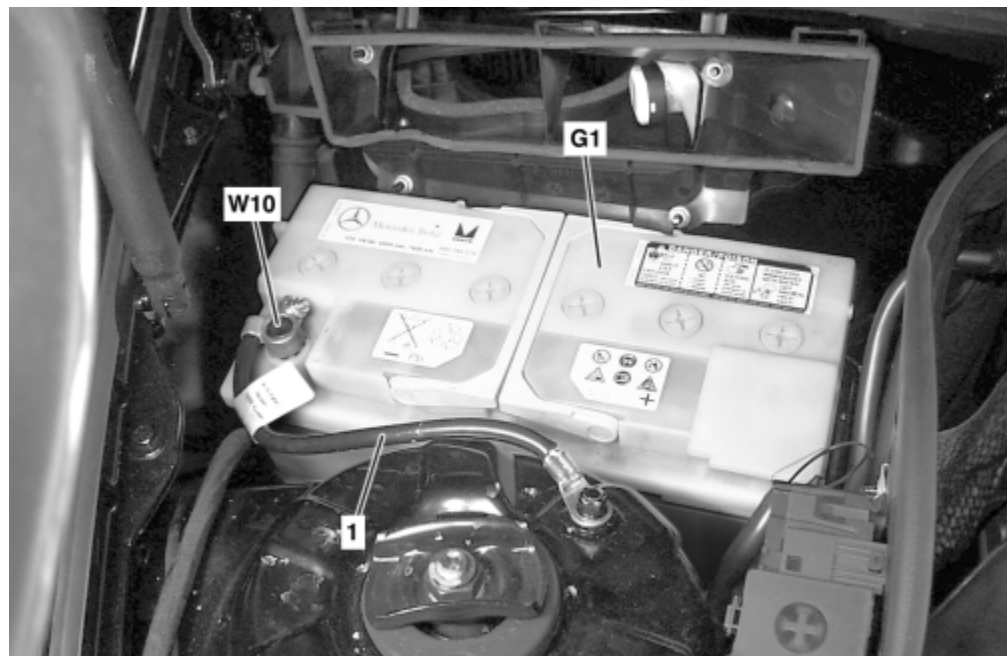

P54.10-2060-06