

**star bulletin**

Date: December 22, 2005  
Order No.: P-B-15.30/55a  
Supersedes: P-B-15.30/55 dated August 24, 2005  
Group: 15

**Revision:**

**SUBJECT: Model 203.040/052/054/056/061/064/065/076/081/084/087/092/261/264/281/284/740/747/764  
All Model Years  
Engine Not Starting / Starter Fuse Malfunctioning**

If you receive customer reports in the above model vehicles of the engine not starting, the Starter Fuse in the Driver Signal Acquisition and Actuation Module (SAM) may be malfunctioning. The Driver SAM should be fitted with a larger 20 Amp fuse.

**Procedure for Model 203**

1. Perform a visual inspection of the Driver SAM (N10/1) and determine which fuse is installed in socket 52 (Figure 1, arrow). Consult STAR Finder for more information on the location of this fuse (10/1f52).
2. Replace the currently installed 15 Amp fuse with the 20 Amp fuse specified in this DTB.
3. Record the fuse rating change on the vehicle's Fuse Chart.

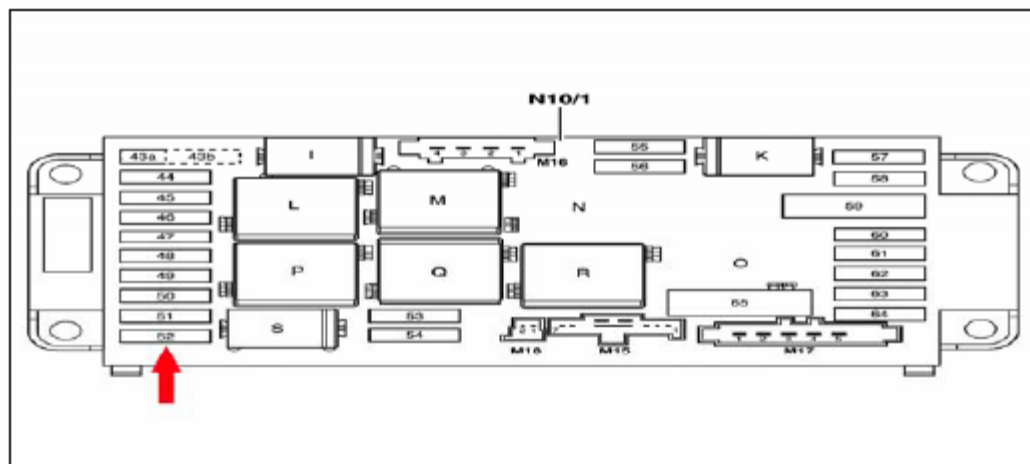


Figure 1

P-

B-15.30-55a

**Parts Information**

Qty.	Part Name	Part Number
1	Fuse 20A	N072581 000306

**i** **Note:** The following allowable labor operations should be used when submitting a warranty claim for this repair.

<b>In Case of Warranty</b>			
<b>Operation:</b> Fuse – specify location, replace (54-1286)			
Damage Code	Operation Number	Time (hrs.)	Model Indicator (s)
54157 C8	54 1286	0.1 hrs.	P1, P2, P3, P4, P5, P6, P7, P8, P9, Q1, Q2, Q3, Q4, Q5, Q6, Q7, Q8, Q9, QA, S1, S2, S3, S4, S5, S6, S7, S8, T1, T2, T3, T4, T5, T6, T7, T8 U1, U3, U4, U5, U6, U7, U8