


| AR46.30-P-0010P | | Fill power steering pump and bleed | | | | |
|-----------------|-------------------|---|----------|--|--|--|
| MODEL | 163.113 /128 /13 | 36, 203.0 /7, 209, 211.020 /022 /061 /065 /070 /076 /080 /082 /083 /084 /089 /220 /222 /261 / | 265 /270 | | | |
| | /276 /280 /282 /2 | 283 /284 /289 /620 | | | | |

MODEL 203.2 except CODE (480) Rear axle level control system

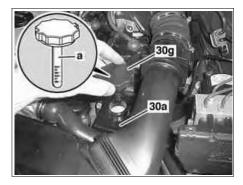

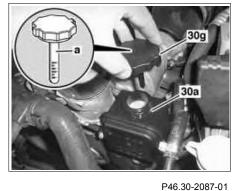

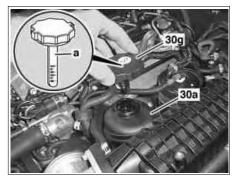

P46.30-2088-01

Shown on engine 112 in model 203

P46.30-2089-01

Shown on engine 611 in model 203

Dipstick

а

30a Power steering expansion reservoir

Shown on engine 111 in model 203

30g Expansion reservoir cover

Modification notes

| 28.7.04 | Raise vehicle until wheels are clear of the ground using lifting platform, added | Step 1 | |
|---------|---|--------|--|
| 28.7.04 | Turn steering wheel slowly from steering stop to steering stop until no more bubbles are ascertained, added | Step 5 | |

| XX | Remove/install | | |
|-----------|---|--|---------------------|
| 1 | Hoist vehicle with lifting platform until wheels are free | Model 211 | AR00.60-P-1000T |
| | | Model 163 | AR00.60-P-1000GH |
| | | Model 203, 209 | AR00.60-P-1000P |
| 2 | Remove left air intake hose | Engine 112, 113 | |
| | Fill | | |
| 3 | Fill expansion reservoir (30a) with MB-steering gear oil | Do not start the engine! If the engine is started there is a risk of air entering the hydraulic steering system, which is then extremely difficult to remove. Fill the expansion reservoir (30a) with MB steering gear oil up to approx. 10 mm below the top edge of the reservoir. Add MB steering gear oil continuously, until the fluid level remains constant. | |
| | | | *BF46.20-P-1001-01A |
| | Bleeding | | |
| 4 | Turn steering wheel from steering stop to steering stop | Do <u>not</u> start the engine! If the engine is started there is a risk of air entering the hydraulic steering system, which is then extremely difficult to remove. Slowly turn steering wheel from steering stop to steering stop until no more bubbles are ascertained in the expansion reservoir (30a). Repeat turning the steering from stop to stop several times (up to 30 times). During this process MB steering gear oil must be added to the expansion reservoir by an assistant. | |
| ⚠ Danger! | Risk of accident caused by vehicle starting off by itself when engine is running. Risk of injury caused by contusions and burns during starting procedure or when working near the engine as it is running | Secure vehicle to prevent it from moving by itself. Wear closed and snug-fitting work clothes. Do not touch hot or rotating parts. | AS00.00-Z-0005-01A |

© Daimler AG, 4/26/19, G/01/14, ar46.30-p-0010p, Fill power steering pump and bleed Page 1 of 2 MODEL 163.113 /128 /136, 203.0 /7, 209, 211.020 /022 /061 /065 /070 /076 /080 /082 /083 /084 /089 /220 /222 /261 /265 /270 /276 /280 /282 /283 /284 /289 /620 MODEL 203.2 except CODE (480) Rear ...

| 6 | Start engine without moving the steering Turn steering wheel from steering stop to steering stop | i Allow engine to run for approx. 1 min at idle speed. i During this process an assistant must observe the steering gear oil level in the expansion reservoir (30a) and add MB steering gear oil if necessary. i When the engine is running, turn the steering wheel slowly several times from steering stop to steering stop, in the meantime refilling the expansion reservoir (30a) with MB steering gear oil. i Repeat process until the steering gear oil level remains constant in the expansion reservoir (30a) and there are no more | 3 |
|------|--|---|------------------|
| | | bubbles. | |
| 4 | Checking | | |
| 7 | Check oil level in expansion reservoir (30a) and fill to maximum fill level | i The oil level in the expansion reservoir (30a) must always be filled up to the maximum level. | |
| ₩ĨAP | Power steering - checking and correcting oil level | Model 211 with diesel engine, 163, 203, 209 | AP46.00-P-4611P |
| ₩AP | | Model 211 with gasoline engine | AP46.00-P-4611BB |
| 8 | Check steering system for leaks | i In the event of leakage, find and eliminate cause. | |
| 9 | Install in the reverse order | | |

Steering gear

| Number | Designation | | | Model 163 | Model 203 | Model 211 |
|--------------------|----------------|----------------------|--------|------------------------|------------------------|------------------------|
| BF46.20-P-1001-01A | Power steering | Filling capacity | Liters | ≈1,2 | ≈1,0 | ≈1,1 |
| | | MB steering gear oil | Sheet | BB00.40-P-0236-03 A | BB00.40-P-0345-00 A | BB00.40-P-0345-00 A |

Steering gear

| Number | Designation | | | Model 209 |
|--------------------|----------------|----------------------|--------|------------------------|
| BF46.20-P-1001-01A | Power steering | Filling capacity | Liters | ≈1,0 |
| | | MB steering gear oil | Sheet | BB00.40-P-0345-00 A |