



DTB

Date: January 15, 2009
Order No.: S-B-82.85/597a
Supersedes: P-B-82.85/597 dated October 5, 2007
Group: 82

Revision History

Revision	Date	Purpose
a	1/15/09	Applicable Models Updated
-	10/5/07	Initial issue

**SUBJECT: Model 204.054/056, as of Model Year 08
Model 204.987, as of Model Year 2010
Equipped with iPod Interface Kit and Audio 20 Head Unit (Option Code 523)
iPod Volume Too Low**

If you receive customer reports in the above model vehicles that the iPod volume is too low in comparison to other audio sources (Example: audio from the CD player or FM), this may be due to a hardware condition in the iPod Interface Module. To remedy, install the iPod amplifier (A204 870 39 94) in line with the iPod Interface kit (Figure 1). Refer to WIS document AZ82.60-P-0014CW (W204) or AZ82.60-P-0014CY (X204).

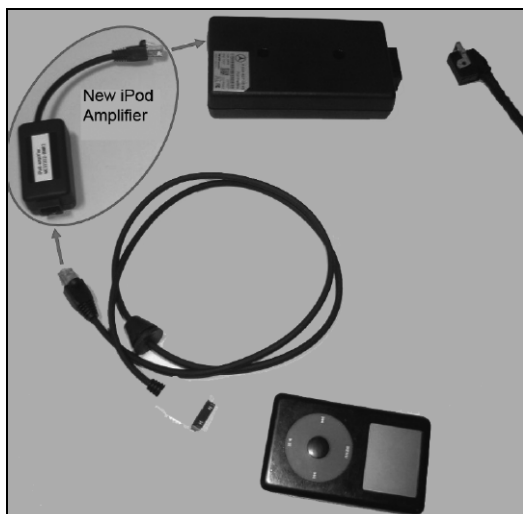


Figure 1 P-B-82.85/597

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

in-line Amplifier connection

Parts Information

Qty.	Part Name	Part Number
1	iPod Booster/Amplifier	A204 870 39 94



Note: The following allowable labor operations should be used when submitting a warranty claim for this repair. This information has been generated on January 15, 2009. Please refer to Netstar → Star TekInfo → Star Time for the most current labor time allowance.

In Case of Warranty

Operation: iPod booster / amplifier, install (82-0000)

Damage Code	Operation Number	Time (hrs.)	Model Indicator (s)
87065 53	82 0000	0.3 hrs. *	CA, CB, XA

* Maximum time allowed with a separate time punch. Ensure that punches are labeled as NON time.