

## Wind or airstream noises in area of doors

Topic number	G172.10-P-061763
Version	2
Design group	72.10 Front door
Date	10-17-2015
Validity	MODEL 205
Reason for change	Remedy: step 7, reformulated.

### Complaint:

Wind or airstream noises in the area of the doors.

### Cause:

Airstream noises, tire noise.

The noises entering the interior are perceived to be too loud.

### Remedy:

1. Check door adjustment. Also check the transition from the doors to the A-pillar, see Figure 1, and correct if necessary by adjusting the doors in the y-direction.
2. Check outside mirror cover for parallelism and correct seating, see Figure 2, and adjust if necessary.
3. Check rib on mirror triangle seal for kinks as per arrows, see Figure 3, and replace if necessary.
4. Cut foam piece to a length of 30mm and attach to waistline trim strip at front on left and right according to the circles, see Figure 3 and Figure 4.
5. Perform a test drive. If the noise level is unchanged, continue with step 6.
6. Using suitable adhesive tape, cover the joints in the area of the front doors, outside mirrors, windshield and enginehood, see example in Figure 5, Figure 6 and Figure 7. Perform a test drive.
7. If the noise level is unchanged, install front side windows with code 851 (Acoustics package).

Note: If there is no improvement on vehicles with code 851 after covering the joints, then there is no remedy at present.

Attachments	
File	Description
Bild 1.JPG	Figure 1
Bild 2.JPG	Figure 2
Bild 3.JPG	Figure 3
Bild 5.JPG	Figure 5

Bild 6.JPG	Figure 6
Bild 7.JPG	Figure 7

10-17-2015 4:16 PM

© Copyright Daimler AG

Page 1/2

## XENTRY

Bild 4.JPG		Figure 4				
<b>Parts</b>						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 205 725 23 00			Left door side window	1		X
A 205 725 18 00			Right door side window	1		X
<b>Operation numbers/damage codes</b>						
Op. no.	Operation text		Time	Damage code	Note	
				72A01 39		
				72N01 39		
<b>WIS-References</b>						
Document number	Title		Note	Allocation		
AR72.10-P-1900LW	Remove/install crank window in front door			Remedy		

10-17-2015 4:16 PM

© Copyright Daimler AG

Page 2/2