Model 167.1/9


except code 21U (Video recording function (Dashcam))

1 Dashcam at front



P54.71-A101-11

2 Dashcam at rear

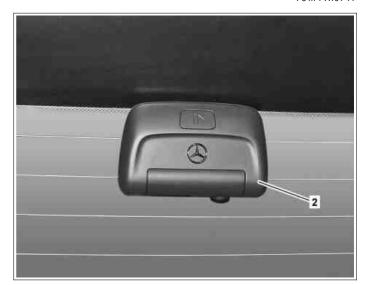

P54.71-A102-11


	Information on preventing damage to electronic components due to electrostatic discharge	AH54.00-P-0001-01A
	Notes on retrofitting electrical/optical lines	AH82.00-P-0000-01A
X	Remove	
1	Remove door sill at front left.	
⊯ AR		AR68.30-P-4100ME
2	Remove trim at bottom for instrument panel or driver's side.	
⊯ AR		AR68.10-P-1501ME
3	Remove A-pillar trim on driver's side.	
⊯ AR		AR68.30-P-4050ME
4	Remove upper B-pillar trim on driver's side and place it to one side with the seat belt attached.	
⊯ AR		AR68.30-P-4700ME
5	Release fuse and relay module on driver's side.	
⊯ AR		AR54.15-P-0003ME
6	Remove front and rear grab handles on the driver's side.	
⊯ AR		AR68.30-P-4330ME


7	Remove covers over securing eyes for front and rear partition net on driver's side.	Y Long wedge	*115589035900
8	Remove left C-pillar trim and place to one side with attached seat belt.	Model 167.1/9	
FAR FAR		Model 167.1 Model 167.9 except code M036 (Maybach version)	AR68.30-P-4490ME AR68.30-P-4490MEX
9 ⊯AR ⊯AR	Remove D-pillar trim on driver's side.	Model 167.1/9 Model 167.1 Model 167.9 except code M036 (Maybach version)	AR68.30-P-4497ME AR68.30-P-4497MEX
10 ≆AR	Remove overhead control panel control unit.	version)	AR82.20-P-1000ME
X 11	Install Retrofit front dashcam mount.		AZ54.71-P-0001-00LWE
		When pressing on, ensure that the pressure is applied directly on the adhesive point. The maximum adhesive strength is only reached after approx. 72 h at 20 °C. During the first hour avoid the application of any mechanical load. Otherwise adhesion problems may occur.	
12	Retrofit rear dashcam mount.	Cleaner	*BR00.45-Z-1025-04A AZ54.71-P-0003-00LWE
		When pressing on, ensure that the pressure is applied directly on the adhesive point. The maximum adhesive strength is only reached after approx. 72 h at 20 °C. During the first hour avoid the application of any mechanical load. Otherwise adhesion problems may occur.	
K.Pl	Barrana	Cleaner	*BR00.45-Z-1025-04A
13	Remove Remove cover for rain and light sensor.		
⊯ AR			AR82.30-P-7801ME
14 ⊯AR	Remove both sun visors.		AR68.60-P-5480ME
15	Pull off front and rear edge guard on driver's side in area of roof lining.		
16	Release front and rear roof lining on driver's side.		
17 ⊯AR	Remove upper liftgate trim.		AD72 20 D 6621ME
X	Install		AR72.20-P-6631ME
18	Retrofit wiring harness for dashcam. Notes on the use of paint scraping nuts on ground connections		AZ54.71-P-0001-01ME AH00.19-P-1000-20A
		Left footwell ground point Silikonspray Silikon-Fluid, 0.4 I art. no. 0893 221 000	*BA00.19-P-1033-01M *BR00.45-Z-1133-06A
		Adhesive tape roll, non-woven Tesa tape, 50 meters, 50 mm wide Wiring harness repair kit, basic	*BR00.45-Z-1144-02A *000589139900
		New passenger car wiring harness repair kit	*220589049900
19	Latch dashcam at front (1) into dashcam mount opposite direction of arrow on eject button.	Mount dashcam at front (1) at the earliest one hour after gluing on the dashcam mount. Otherwise, the dashcam mount may work its way loose.	
20	Latch dashcam at rear (2) into dashcam mour opposite direction of arrow on eject button.	Mount dashcam at rear (2) at the earliest one hour after gluing on the dashcam mount. Otherwise, the dashcam mount may work its way loose.	
21	Perform initial startup.		AZ54.71-P-0001-02LWE
⊯ GF 22	National settings for Mercedes-Benz dashcam Install remaining parts.		GF54.71-P-0010-02LWE
	Update Vehicle Documentation (VeDoc)		
23	Attach "Mercedes-Benz dashcam retrofitted at front and rear as per AZ54.71-P-0001ME note" under field organization texts to DG 54, DG 67 and DG 68.		
© Moreodos Ponz AC 9/9/00 1	_/10/20, az54.71-p-0001me. Retrofit front and rear Mercedes-Ben	7 Dooboom	Page 2 of 3


4	Check		
24	Perform function test.	i See Owner's Manual.	

Nm Ground points

Number	Designation			Model 167
BA00.19-P-1033-01M	Left footwell ground point	W34	Nm	10

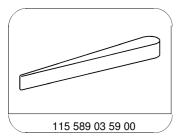

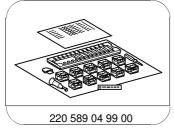

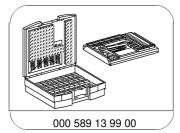

Long wedge New passenger car wiring harness repair kit

Wiring harness repair kit, basic

Repair materials

Number	Designation	Order number
BR00.45-Z-1025-04A	Cleaner	A 005 989 19 71
BR00.45-Z-1133-06A	Silikonspray Silikon-Fluid, 0.4 l art. no. 0893 221 000	Adolf Würth GmbH & Co. KG Reinhold-Würth-Str. 12-17 74653 Künzelsau-Gaisbach Germany Tel. +49 7940 15-0 Fax +49 7940 15-1000 http://www.wuerth.de
BR00.45-Z-1144-02A	Adhesive tape roll, non-woven Tesa tape, 50 meters, 50 mr	m wide A 008 989 50 85 09

Parts ordering note

Part no.	Designation	Quantity
KG 98 (siehe EPC)	Dashcam parts kit	1