

INVOICE

Service: (973) 267-9205
Parts: (973) 267-9209
Body Shop: (973) 267-9222
Sales: (973) 267-5000

JUSTIN A KILISZEK
173 DRAKE LN
LEDGEWOOD, NJ 07852

HOME: 973-945-5163 CONT: N/A
BUS: 973-945-5163

SERVICE ADVISOR: 305 EDWARD SALWAN
MORRISTOWN, NJ

DEL DATE	PROB DATE	WARR EXP	PROMISED	PO NO	RATE	PAYMENT	INV DATE
775/281	07	MERCEDES BENZ CLS500	WDDDJ77X67A085284		ISELHMZ	49980/4998	12321

05AUG06	DD08JUL06	03AUG2010	10:48	25JAN11	CASH		03FEB11
---------	-----------	-----------	-------	---------	------	--	---------

R/O OPENED		READY	OPTIONS: DLR:55138 ENG:15698360001806	TRN:72290700779907 AXL:2193771A085284
------------	--	-------	---------------------------------------	---------------------------------------

11:04	24JAN11	12:50	03FEB11
-------	---------	-------	---------

LINE	OPCODE	TECH	TYPE	HOURS

7 BK	1/2 BRAKE CILN	3.20	3.20	984.00
------	----------------	------	------	--------

1 000-180-30-09	FILTER	20.35	20.35	20.35
-----------------	--------	-------	-------	-------

1 007603-012106	RING	1.65	1.65	1.65
-----------------	------	------	------	------

10 O 1 09 0015	0M40	6.75	6.75	67.50
----------------	------	------	------	-------

49980	UNDERCARRIAGE INSPECTION	FOUND DAMAGE TO ENCAPSULATION PANELS BUT NO DAMAGE TO BODY OR FRAME. NOTED CRACKED INNER TIE OF L/R WHEEL. R/R ENCAPSULATION PANELS AND FOUND R/S OF ENGINE COMPLETELY COVER IN OIL AND ALL THE WAY BACK FROM TRANSMISSION TO DIFF. HAS OIL RESIDUE CLEANED ENGINE AND CHECKED OIL LEVEL. FOUND 3 OILS LOW. RAN ENGINE AFTER CLEANING BUT FOUND NO SOURCE OF LEAK. ELECTRONIC COMPRESSION TEST WITH DAS FOUND AN RPM DIFFERENCE OF 86 RPM DETECTED. ENGINE INTEGRITY TESTS RECOMMENDED. R/R SPARK PLUGS. NOTED OIL RESIDUE ON PUG #3. PERFORMED CYL LEAK DOWN TESTS. PASSED. LEAKDOWN 5% OR LESS ON ALL CYLS. INSPECTED CYLS WITH BORESCOPE. FOUND NO DAMAGE AND CORROSION BUILDUP/FRAGILE. PERFORMED OIL PRESSURE TEST. PASSED WITH 4 BAR. PERFORMED OIL/FILTER CHANGE TO ENSURE PROPER OIL IS IN VEHICLE. ROAD TEST VEHICLE AND CONTINUED TO CLEAN RESIDUE OF OIL FROM R/S ENGINE. FOUND NO LEAKS, WITH EXCEPTION OF SMALL AMOUNT AT OIL CAP. FOUND ENGINE THROTTLE RESPONSE GOOD. NOISE CODES IN FAULT MEMORY (SEE LINE C) AND NOTED ENGINE NOISE. RECOMMENDED REPLACEMENT OF CAM TIMING ADJUSTERS AND VALVE TAPPETS. ALSO POSSIBLE NEED OF NEW CAM SHAFTS. INSPECTION NEEDED. ALSO RECOMMEND RESET OF INTRAVE MANIFOLD. CUSTOMER TO COLLECT VEHICLE.
-------	--------------------------	--

B CLIENT STATES HIT SOMETHING ON ROAD AND OIL LEAKING INSPECT AND REPORT

308	CC	0.00	0.00
-----	----	------	------

82 ACCESSORY ELECTRIC

TOW CAR WAS TOWED IN

308	CC	0.00	0.00
-----	----	------	------

49980 CONFIRMED CHECK ENGINE LIGHT IS ON. RAN SHORT TEST. FOUND FAULT

LABOR AMOUNT	984.00
PARTS AMOUNT	22.40
GAS, OIL, LUBE	20.35
SUBLET AMOUNT	1.65
MISC. CHARGES	67.50
TOTAL CHARGES	1076.90
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	1076.90

ON BEHALF OF SERVING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INFLATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE THAT CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION BY MANUFACTURER'S REPRESENTATIVE.

DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE) CUSTOMER SIGNATURE

ACKNOWLEDGE THAT ALL REQUESTED AND/OR ADDITIONAL WARRANTY WORK WAS EXPLAINED TO ME AND PERFORMED AT NO CHARGE. NOTICE OF DISCLAIMER. Dealer guarantees the labor performed in this report has been competently performed, and that any defect which occurs will be corrected without charge by this shop for a period of 90 days or 4,000 miles from the date of the repair, whichever first occurs. Except for wear and tear, and alignment, this repair is sold "as is". The only warranties applying to this repair are those which may be offered by the manufacturer. The selling dealer hereby expresses disclaimers all warranties, either express or implied, including any implied warranties of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this part and/or service. Buyer shall not be entitled to recover from the selling dealer any consequential damages, damages to property, damages for loss of use, loss of time, loss of profits, or income, or any other incidental damages. In addition, expressly excluded is any dealer liability for defects pertaining to safety or performance, by way of "brake failure", "negligence or otherwise."

Thank You!

Thank You!
Customer Copy

1 (SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)		CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT	1172.61
MANUFACTURER'S REPRESENTATIVE		dealer any consequential damages, damages to property, or loss of use, loss of time, or income of any kind incidental damage, in addition to the cost of parts and labor for the repair.	SALES TAX	76.71
YEAR FROM THE DATE OF PAYMENT NOTIFICATION		dealer will not be entitled to recover from the selling dealer any other person to whom it is sold in connection with the sale of this part(s) and/or service. Buyer shall not be entitled to recover from the selling dealer any consequential damages, damages to property, or loss of use, loss of time, or income of any kind incidental damage, in addition to the cost of parts and labor for the repair.	LESS INSURANCE	0.00
SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT OWNER THERE WAS NO INDICATION FROM THE DESCRIBED WERE PERFORMED AT NO CHARGE TO ACCURATE UNLESS OTHERWISE SHOWN. SERVICES THAT THE INFORMATION CONTAINED HEREON IS ON BEHALF OF SERVING DEALER, I HEREBY CERTIFY		NOTICE OF DISCLAIMER I ACKNOWLEDGE THAT ALL REQUESTED AND/OR ADDITIONAL WARRANTY WORK WAS EXPLAINED TO ME AND PERFORMED AT NO CHARGE.	TOTALS	984.00
			LABOR AMOUNT	984.00
			PARTS AMOUNT	111.90
			GAS, OIL, LUBE	0.00
			SUBLET AMOUNT	0.00
			MISC. CHARGES	0.00
			TOTAL CHARGES	1095.90
				0.00
				0.00

THANK YOU

THANK YOU FOR CHOOSING MERCEDES-BENZ OF MORRISTOWN FOR YOUR AUTOMOTIVE NEEDS. WE APPRECIATE YOUR PATRONAGE. WE WILL DO EVERYTHING IN OUR POWER TO KEEP YOU AS A "HAPPY CUSTOMER".

 LINES ABOVE FOR FINDINGS AND RECOMMENDATIONS.
 49980 DID NOT DUPLICATE CONCERN. FOUND THROTTLE RESPONSE GOOD. SEE 308 CC
 82 ACCESSORY ELECTRIC

D CLIENT STATES POOR THROTTLE INSPECT AND REPORT

 DID NOT RETURN. SEE ESTIMATE. RECOMMEND CAM TIMING CONTROLS BE REPLACED. TEST VEHICLE FOUND ENGINE RUNNING AND PERFORMANCE GOOD. NOTED CODES CHECK ENGINE LIGHT BEING ON AT THIS TIME. CLEARED FAULT MEMORY AND ROAD FOUND CODE 0275 (I/S INTAKE CAM POSITION FAULT) CURRENT AND CAUSE OF CAM TIMING FAULT) & 0645 (MISSFIRE CYL 2) ALL STORED IN ENGINE MODULE. EXHAUST CAM POSITION FAULT), 0061 (MISSFIRE CYL 8), 1200 (R/S EXHAUST SENSOR FAULT) 1204 (I/S EXHAUST CAM ADJUSTMENT FAULT), 0064 (I/S CODES 0629 (MISSFIRE), 0657 (MISSFIRE CYL 7), 0768 (I/S EXHAUST CAM

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

11:04 24JAN11	12:50 03FEB11	TRN:72290700779907 AXL:2193771A085284	OPTIONS: DLR:55138 ENG:15698360001806	R.O. OPENED	READY
05AUG06 D08JUL06	03AUG2010 10:48 25JAN11				
DEL DATE	PROD DATE	WARR EXP	PROMISED	PD NO	RATE
775/281	07	MERCEDES BENZ CL500	WDDJ77X67A085284	ISELHMZ	49980/49998
COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT
BUS:		CELL:973-945-5163			

SERVICE ADVISOR: 305 EDWARD SALWAN

HOME:973-945-5163 CONT:N/A

JUSTIN A KILISZEK
 173 DRAKE LN
 LEDGEWOOD, NJ 07852

PAGE 2

Part: (973) 267-9209 Body Shop: (973) 267-9222
 Sales: (973) 267-5000

* INVOICE *

Service: (973) 267-9205

Morristown, NJ 07962-2269

34 Ridgedale Avenue

Mercedes-Benz of Morristown

4 5 2 6 9 2

CUSTOMER #: 9739455163

1.0 Oil Pressure Test
 Compression Test - Leakdown
 658.00

Line	Qty	Part Description	Estimate
1.0	1	ENCAPSULATION PANELS	418.00 @
1.8	1	FRONT CASTER STRUT BUSHINGS	65.00 x 2
6.0	1	LEFT AND RIGHT AIRMATIC SPRINGS	1130.54 x 2
8.0	1	L/R RIM CRACKED INNER LIP	1150.00 @
1.0	1	DIO	156.050 3547 @


Additional Info:
 VIN: WDDJ77X67A085284 Year: 07 Make: MB Model: CL5500
 Mileage: 49980
 Engine: 15698360001806
 Transmission: 72290700779907
 Axle: 2193771A085284
 Options:
 Production Date: 07/08/06
 Delivery Date: 08/05/06
 In-Service Date: 08/04/06

Customer Number: 9739455163
 Customer Name: KILISZEK, JUSTIN A
 Customer Address: 173 DRAKE LN
 City, ST, ZIP: LEDGERWOOD, NJ 07852
 Phone: H: (973) 945-5163 B:
 Date/Time: 01/25/11/09:16:39
 Technician: 308 MAXWELL, ROBERT
 Service Advisor: 305 SALMAN, EDWARD
 Repair Order: 452692 Tag: T2321

Promise date: 01/25/11
 Promise time: 10:48
 Page 1 of 2

Handwritten notes:
Jerry
8500
0675

Handwritten notes:
Cams
LE
LH
RE
0/4

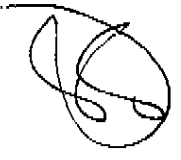

Line	QTY	Part Description	ESTIMATE
			Value covers
		CAM ADJUSTERS	
		L/I 156-050-3547 N 74000 (N3)	
		L/E 156-050-3547 N 74000	
		R/I 156-050-3547 N 74000	
		R/E 156-050-3547 N 74000	
		VALVE LIFTERS	
		156-0500225 N 74000 X32	
		156-010021 N 74000	
		156-0160121 N 74000	
		ALL GASKETS FOR INTAKE MANIFOLD	
		156-1410480 (N) 74000 X8	
		156-238-0280 N 500 X2	
		AND BOLTS	
		004990312 (N) 74000 X10	
		MISC: 300.00\$	

Additional Info:

Warranty Parts Returned [] Core Return

Technician's Signature

Customer Number: 9739455163
 Customer Name: KILISZEK, JUSTIN A
 Customer Address: 173 DRAKE LN
 City, ST, ZIP: LEDGEWOOD, NJ 07852
 Phone: H: (973) 945-5163 B:
 VIN: WDDDJ77X67A085284 Year: 07 Make: MB Model: CL5500
 Mileage: 49980
 Engine: 15698360001806
 Transmission: 72290700779907
 Axle: 2193771A085284
 Options:
 Additional Info:

Service Advisor: 305 SALWAN, EDWARD
 Technician: 308 MAXWELL, ROBERT
 Repair Order: 452692 Tag: T2321
 Date/Time: 01/28/11/15:42:48
 Promise date: 01/25/11
 Promise time: 10:48