

SUBJECT:

Model 203.061/064/065/261/264/740/747/764, Up to VIN F401823
(not including 4 - Matic)

Model 209.365/375/376, Up to VIN F045619

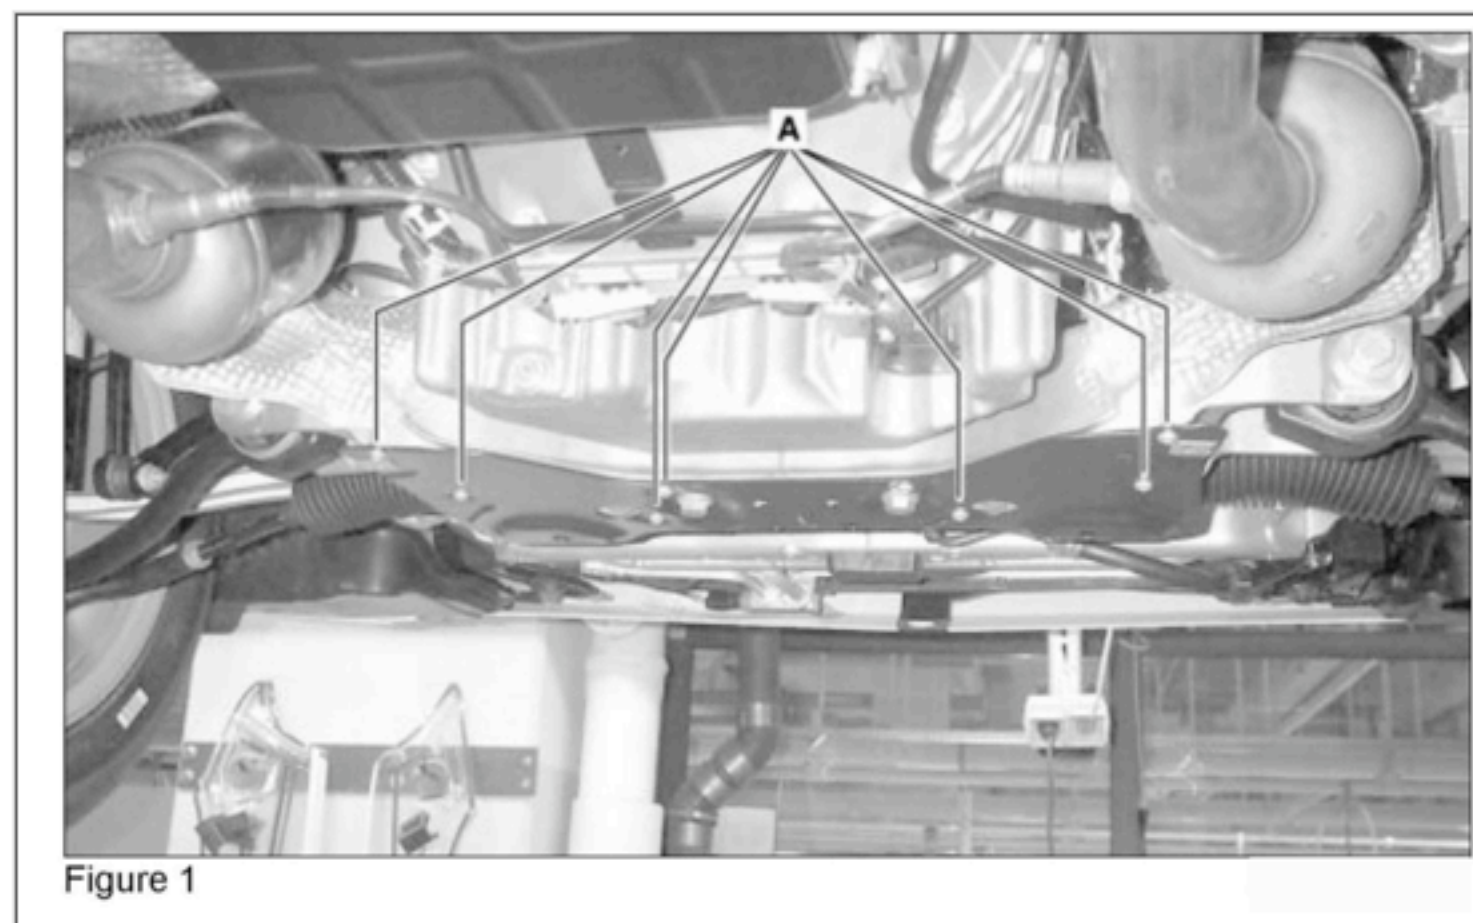
Rattling Noises from Front Axle

Figure 1

Zoom

Sized for Print

If you receive customer reports in the above model vehicles of rattling noises from front axle, the cause may be that the blind hole in the frame for mounting the stiffening plate may be too shallow (Figure 1, A). As a result, noise complaints due to the insufficient clamping force on the stiffening plate is possible. If this situation is found to exist, remove the bolts, install a 6 mm washer, reinstall the bolts and torque to a value of 12 Nm.

Qty.	Part Name	Part Number
7	6 MM flat washer	N000125 006449

Zoom

Sized for Print