

Service Campaign Bulletin

FILE: SERVICE: GROUP 00 OF SERVICE INFORMATION BINDER
PARTS: GROUP I OF INFORMATION _ PARTS & ACCESSORIES BINDER

Campaign No. 2008020003, March 2008

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **MODEL 204, MODEL YEAR 2008**
REPLACE ELECTRONIC IGNITION SWITCH

Daimler AG has determined that the EIS may malfunction preventing the electric steering lock and the central locking from functioning. Dealers will replace the EIS on the affected vehicles during the next workshop visit.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the procedure steps exactly as described.

Please note that Recall and Service Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 10 vehicles are affected.

Order No. P-SC-2008020003

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Procedure**Note: Prior to starting the procedure ensure to:**

- Use DAS 02/08 with all associated patches or higher.
- Follow the steps exactly as described in DAS.
- Connect battery charger.

1. Connect Star Diagnosis to the vehicle.
2. Transfer the settings of the EIS control module to Star Diagnosis by navigating through the following screen menus: Main Groups/Control Units/Body/EZS – Electronic ignition switch/Initial Startup (follow on-screen instructions).
3. Replace EIS, refer to WIS: AR46.10-P-0810CW.
4. Continue with Initial Startup (follow on-screen instructions).

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Electronic ignition switch	A204 545 14 08	100%
1	Orange workshop key ¹⁾	A000 766 96 06 9999	100%

¹⁾ Must be ordered by VIN

Note:

- Please be aware that only the part number(s) referenced in the Campaign Bulletin is/are approved for use to repair the vehicle. Repairs performed using any other part(s) will not have been performed in accordance with the campaign. Accordingly, warranty claims submitted with reference to an improper part number(s) will be denied.
- The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Replace electronic ignition switch (EIS) control module (02-5644).
 Connect/disconnect Star Diagnosis (02-4762).
 Connect/disconnect battery charger (with SDS connected) (02-5058).

Damage Code	Operation Number	Labor Time (hrs.)	Model Indicator(s)
46 926 31 7	02-5644	1.0	CA, CB
	02-4762	0.1	
	02-5058	0.1	