TIME OFCOD	E TECH TYPE HOURS	LIST NE	TOTAL
	TES INTERMITTENTLY ENGINE HAS REDUCED/LOSS OF OCK)	POWER (SOP IN	
CAUSE: FOU	ND CODE P023409, VACUUM HOSE FOR WASTEGATE ACT RBOCHARGER (09B01-A2 7)	TUATOR FOR LEFT	•
54065	O ON-BOARD POWER SUPPLY VOLTAGE MAINTAIN		
(WHEN CHECKING/ TESTING AND TROUBLESHOOTING)			
	631 W08		(N/C)
54101	1 PERFORM QUICK TEST 631 W08		(N/C)
140000 PER LI, REMOVED VACUUM HOSE FOR WASTEGATE			(14/ C)
ACTUATOR FOR LEFT TURBOCHARGER AND REPLACED			
	WITH NEW MOLDED VACUUM HOSE.		
	631 W08		(N/C)
1	177-142-06-00 VACUUM LINE		(N/C)
PARTS:	andre modelli. William	OTAL LINE A:	0.00
6022 PER LI07.09-P-063678, DC 09B01A27			
54-0650[0.1]54-1011[.2]14-0000[0.1]zm. Performed short test. Found			
fault code P023409 stored in engine control unit. LI07.09-P-063678 as			
per LI removed vacuum hose for wastegate actuator for left turbochager			
and replaced with new molded vacuum hose. Cleared fault codes after			
repairs.			

B REWORK CONNECTOR HOUSING AT ELECTRONIC LOCKING DIFFERENTIAL			
CAUSE: PERFORM CAMPAIGN #2016020009 (32920-31 7)			
029216 REWORK PLUG AT ELECTRONIC LOCKING			
DIFFERENTIAL			
631 W08			(N/C)
1 000-545-84-19 HOUSING SEAL			(N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B:			0.00
6015 PERFORMED CAMPAIGN #2016020009 - disconnected electronic diff			
connector and installed weather plug in open cavity. Reconnected			
connector after repairs.			

C RETROFIT	TWO STOP PLUGS AT RIGHT SPARE WHEEL WELL		
	I acknowledge notice of an increase of the original estimated price and additional	DESCRIPTION	TOTALS
	customer or warranty work performed, and or receipt of vehicle.	LABOR AMOUNT	
		PARTS AMOUNT	
	XCUSTOMER SIGNATURE	GAS, OIL, LUBE	
		SUBLET AMOUNT	
FOLLOWING	Thank you for choosing Mercedes-Benz of Palm Springs. We greatly appreciate	MISC. CHARGES	
FOLLOW US ON FACEBOOK	your business. It is our sincere hope that your service experience was a pleasant	TOTAL CHARGES	
	one, and it is our intention to make your ownership experience one of complete satisfaction. If for any reason you cannot answer the questions in the	LESS INS/ADJ.	
	manufacturers survey with the highest rating, please contact our Service	SALES TAX	
	Manager at (760) 328-6525. Thank you.	PLEASE PAY	