12/14/23, 8:07 PM ServiceCartApp

Multi Point Inspection

\$399.95





Needs Immediate Attention: (5 items)

APPROVE REMAINING(\$22262.74)

YOUR CONCERN

CLIENT STATES THE CHECK ENGINE LIGHT IS ON, AND THE ENGINE IS RUNNING ROUGH. CHECK AND **ADVISE**

Comments: CODE P001685 The position of the intake camshaft (cylinder bank 1) is implausible relative to the position of the crankshaft. There is a signal above the permissible limit value IN ENGINE CONTROL UNIT. ALSO RATTLE HEARD WHEN ENGINE FIRST STARTS UP AND THERE IS AN EXTENDED CRANK CONDITION. NEED TO REPLACE CAMSHAFT ADJUSTER AND CAMSHAFT. CAMSHAFT PULSE WHEEL SHIFTED AND ADJUSTER CAUSING NOISE.

> Repair Estimate: \$10387.67

Original Approved: \$319.95

TOTAL APPROVED: \$319.95

DECLINE APPROVE

Drive Shaft Boots / Constant Velocity Boots / U-joints / Transmission Linkage (if equipped)

Comments: RIGHT FRONT CV BOOT TORN ON THE INNER BOOT AND SEASE FOO ESTIMATES. CV JOINT IS NOW CONTAMINATED WITH DIRT AND DEBRIS

12/14/23, 8:07 PM ServiceCartApp

INSIDE. RECOMMEND REPLACING COMPLETE CV $\equiv_{\mathsf{AXLE}\ \mathsf{RF}} \mathsf{Multi}\ \mathsf{Point}\ \mathsf{Inspection}$ \$319.95

Repair Estimate: \$2919.93

DECLINE

APPROVE

Engine/Transmission Mounts

Comments: WORN ENGINE MOUNTS CAUSING VIBRATION WHEN ENGINE IS ON. RECOMMEND REPLACE ENGINE MOUNTS AND TRANSMISSION MOUNT.

> Repair Estimate: \$5030.00

DECLINE APPROVE

Tire Measurements

Comments: LEFT FRONT TIRE SHOWING CORDS. RF EXCESSIVELY FEATHERED. RECOMMEND REPLACE **BOTH FRONT TIRES**

LEFT FRONT TIRE TREAD RIGHT FRONT TIRE TREAD

DEPTH **DEPTH**

Condition 5

/32" /32"

 
LEFT REAR TIRE TREAD RIGHT REAR TIRE TREAD

DEPTH **DEPTH**

9 /32" /32"

> Repair Estimate: \$821.32

DECLINE APPROVE



Comments: WHEN PERFORMING REPAIR FOR CHECK ENGINE LIGHT THERE IS A CHANCE THE TURBO COOLANT LINES COME APART AND BREAK, THEY ARE PLASTIC AND BRITTLE. TURBO PIPING AND DUCTING NEEDS TO COME OFF AND ITS VERY CLOSE TO LINES. PROVIDING ESTIMATE IN THE EVENT IT DOES NEED THEM.

> Repair Estimate: \$3103.82

DECLINE

APPROVE



Needs Attention Soon: (2 items)



Comments: VEHICLE WILL NEED FOUR WHEEL ALIGNMENT IF TIRES ARE REPLACED, IF ENGINE MOUNT REPAIR IS PERFORMED, OR IF THE CV AXLE REPLACEMENT IS PERFORMED.

ALIGNMENT CHECK RECOMMENDED


Caution

REQUEST ESTIMATE





A Rear Brakes Linings Thickness


Comments: REPLACE REAR BRAKE PADS SOON

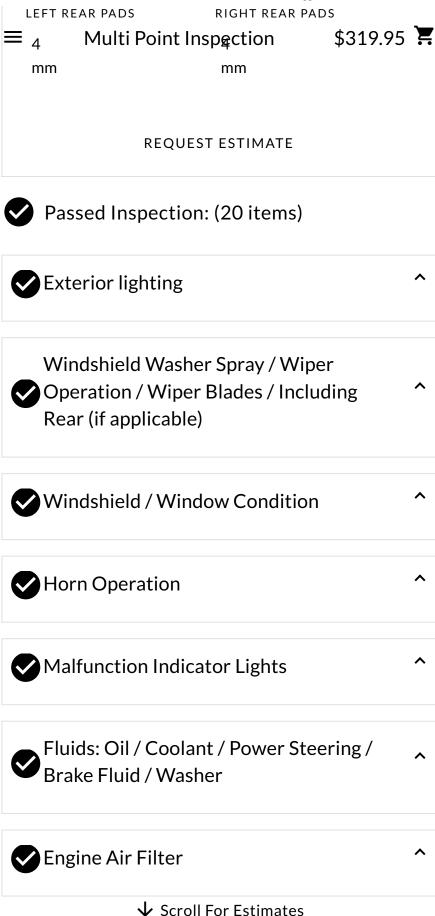


  
https://app.mykaarma.com/service-cart/mpi/EqsvuGzQwPDPVcTUwI2h0pVLk679sfs-OEebcq2TMcg/detail

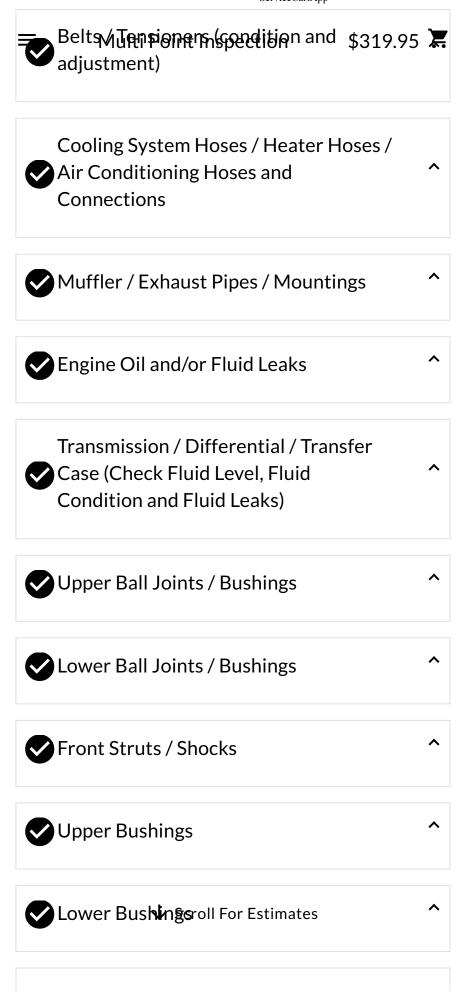

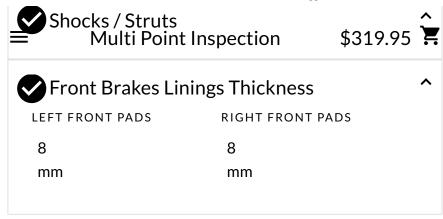

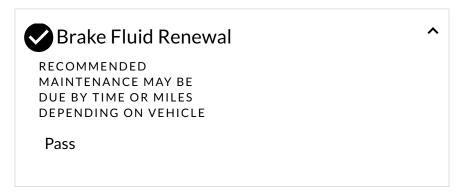





Terms of Service (https://docs.google.com/document/d/e/2PACX-

1vTssbasg7j6b0SGqcej58JOUkhn06VDB28snZi3i9CxZgjt8eF4sgf0PUYHYaXZGB6AOwhS-

pvSls6s/pub) | Privacy Policy (https://docs.google.com/document/d/e/2PACX-

(https://docs.google.com/document/d/e/2PACX-

1vTA5CaMSqr2JZqJrYQyIUYTcrpWrMwp6sqXxwiQw0VO9Y9QOtqxFw_iKRUdtcNIHPTp6CzpJxJeeC88/pub#id.jajqwe9ydww