


MODEL 209.4## 1#
 with CODE (494) USA version
 with CODE (806) Model year 2006
 with CODE (810) Sound system
 with CODE (359) TELE AID emergency call system

 



 

MODEL 209.4## 1#
 with CODE (494) USA version
 with CODE (807) Model year 2007
 with CODE (810) Sound system
 with CODE (359) TELE AID emergency call system


- 1 SDAR control unit
- 2 SDAR antenna
- 12 SDAR bracket

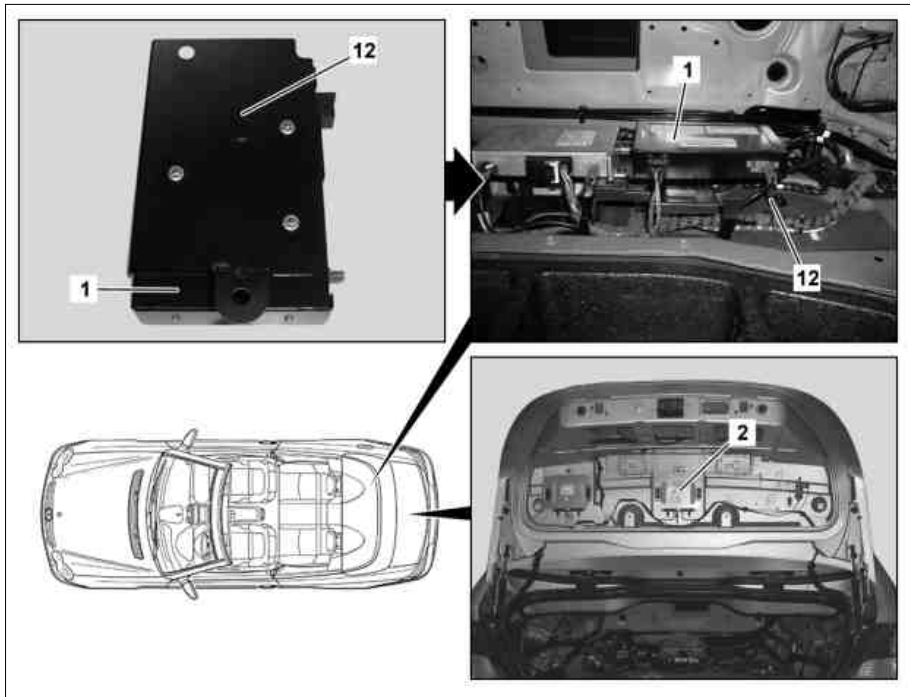

P82.60-5769-06

✕	Removal		
⚠		Notes on avoiding damage to electronic components due to electrostatic discharge	AH54.00-P-0001-01A
1 ⚠ AR ⚠ i		<p>Risk of explosion caused by escaping oxyhydrogen gas. Risk of injury caused by caustic burns to eyes, skin and mucous membranes from battery electrolyte (contains diluted sulfuric acid) or metal spatter due to short circuit. Risk of burn injuries caused by swallowing battery electrolyte (contains diluted sulfuric acid) or absorption of lead over the skin or orifices</p> <p>Disconnect battery ground cable</p> <p>Notes on battery</p> <p>Notes on AGM battery</p>	AS54.10-Z-0001-01A AR54.10-P-0003Q AH54.10-P-0001-01A AH54.10-P-0002-01A
2 ⚠ AR		Remove coverings in trunk	AR68.30-P-4600QA
3 ⚠ AR		Remove paneling from trunk lid	AR68.30-P-8150Q
4 ⚠ AR		Remove rear SAM control unit with fuse and relay box	i Do not disconnect electrical connectors. style="color: red;">AR54.21-P-1259QA
5		In luggage compartment, expose control unit plate with installation location for SDAR control unit (1)	
✕	Install		
6		Retrofit satellite radio control unit	AZ82.60-P-0006-01QA
7		Retrofit antenna line	AZ82.70-P-0002-01QA
8		Retrofit satellite radio antenna	AZ82.60-P-0006-02QA

9	Retrofit wiring harness.	 Wiring harness for SDAR. 	AZ82.70-P-0001-04QA *220589029900
10	Retrofit MOST fiber optic cable wiring harness	 MOST fiber optic cable wiring harness for SDAR.	AZ82.60-P-0006-03QA
11	Install in the reverse order	 Steps 5 up to 1.	
12	Perform retrofit variant coding	 Perform variant coding using STAR DIAGNOSIS to activate the satellite radio (SDAR) functions. After completing variant coding, perform a quick test and delete the fault memory.	
13	Perform function check on SDAR		
14	Add special equipment to the vehicle data card and to the online vehicle data card	 Enter SIRIUS satellite radio (code 536).	

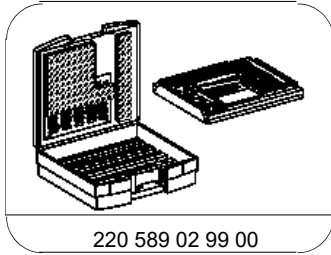

Wiring harness repair kit

Parts ordering notes

Part no.	Designation	Quantity
B6 783 00 72	SDAR assembly kit	1
B6 783 01 03	SDAR wiring harness	1
B6 783 01 02	SDAR-MOST wiring harness	1
B6 783 00 60	SDAR receiver	1
B6 783 01 15	SDAR receiver bracket	1
B6 783 01 01	SDAR antenna line	1
B6 783 01 17	SDAR antenna wiring harness	1
B6 783 01 13	SDAR antenna	1