

## Dynamic seat inoperative

Topic number	LI91.25-P-052529
Version	1
Design group	91.25 Multicontour seat (MCS)
Date	09-30-2011
Validity	Model series 212 and 218 with SA code 432 (Active multicontour seat)
Reason for change	

### Complaint:

Dynamic seat inoperative shortly after restart.

Fault code 9E8900 stored in control unit (N32/19, N32/22).

### Cause:

Time limits for venting process exceeded

### Remedy:

Flash left front active multicontour seat control unit (N32/19) or right front active multicontour seat control unit (N32/22) with new software.

Extension of time limits with new software available as of DVD 05/11.

Software number, left A 212 902 73 04

Software number, right A 212 902 74 04

### Symptoms

Seat / Body / Dynamic multicontour seat / Nonfunctional /

### Control unit/fault code

Control unit	Fault code	Fault text
AMKS-LF - Active multicontour seat (N32/19) (MCMSFL_212)	9E8900	The air cushions in the seat cannot be deflated.
AMKS-RF - Active multicontour seat (N32/22) (MCMSFR_212)	9E8900	The air cushions in the seat cannot be deflated.
AMKS-RF - Active multicontour seat (N32/22) (MCMSFR_212)	9EA953	The pneumatic pump for the multicontour seat has a malfunction. The component is deactivated.
AMKS-LF - Active multicontour seat (N32/19) (MCMSFL_212)	9EA953	The pneumatic pump for the multicontour seat has a malfunction. The component is deactivated.

---

Work units				
Op. no.	Operation text	Time	Damage code	Note
			91C09 90	Left front active multicontour seat control unit
			91R09 90	Right front active multicontour seat control unit