

## Engine dies immediately after starting

Topic number	LI07.08-P-055310
Version	5
Design group	07.08 Control modules
Date	06-27-2013
Validity	Engine 276 in vehicle models 166, 172, 204, 207, 212, 218, 231; engine 278 in vehicle model X166.
Reason for change	Vehicle models 221 and 251 excluded. They remain for M276 with VC10.

**Complaint:**

Engine intermittently dies immediately after starting. When restarted, the engine starts up and does not stop again. More commonly observed on repeated starts after short trips and short parking times.

No fault entries in the gasoline engine control unit.

**Cause:**

Applicative actuation of the injectors by the gasoline engine control unit.

**Remedy:**

Engine 276:

Please download the following add-ons for Xentry Diagnosis and update the software for the gasoline engine MED 17.7 control unit.

For Xentry data release 03/2013 and higher: No add-on necessary.

Engine 278 in model series 166:

Please download the following add-ons for Xentry Diagnosis and update the software for the gasoline engine MED 17.7 control unit.

For Xentry data release 03/2013 and higher: No add-on necessary.

Please do not replace any components of the gasoline engine or the fuel system. The complaint is a software problem; replacing parts does not correct the fault.

<b>Symptoms</b>
Power generation / Engine management / Engine running / Stalls/goes out

<b>Work units</b>				
Op. no.	Operation text	Time	Damage code	Note

---

		54575 90	
--	--	----------	--