

## Blower Regulator No Longer Functioning DTC B112F87

Topic number	LI83.10-P-060852
Version	1
Design group	83.10 Ventilation
Date	02-17-2015
Validity	All model years
Reason for change	

### Complaint:

In cold temperatures and low humidity conditions, the climate control blower may no longer function. Function may reset after key cycle.

### Cause:

Blower regulator LIN function is disrupted due to Electro Static Discharge (ESD). Function is usually restored after power is reset to regulator.

### Remedy:

New part to be made available will have necessary ESD protection. ETA end of March availability.

Note: Currently available spare part does not have ESD proofing and could cause the same complaint.

Control unit/fault code		
Control unit	Fault code	Fault text
AAC - Air conditioning (N22/1) (HVAC222)	B112F87	The front blower regulator has a malfunction. The message is missing.

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 222 906 03 03			Blower Regulator			X