

AF54.21-P-3000A	Cold air following stationary heater operation and/or REST operation	28.1.03
-----------------	--	---------

MODEL 211 with CODE (228) Stationary heater

**Modification notes**

21.9.05	Damage code completed, control units added under cause and Parts ordering notes updated		
---------	---	--	--

**Operation no. of operation texts or standard texts and flat rates**

Category	Op. no.	Operation text
P	541011	Perform quick test
P	547989	Disconnect, connect ground cable on vehicle electrical system battery (when disconnecting electrical connector with KL. 30)
P	542461	Replace module for signal acquisition and actuation on left in engine compartment (after checking)
P	023472	Recode driver's side SAM control unit with fuse and relay module (N10/1) (after testing)

Damage code	Cause	Remedy	
54 584 73	SAM control unit (N10/1) does not control the heat exchanger shutoff motor (M16/32). <i>i</i> Affected control units: A 002 545 87 01 A 211 545 28 01 A 211 545 30 01 A 003 545 59 01	1 Remove/install/replace N10/1 <i>i</i> The new SAM control unit (N10/1), see Parts ordering notes for part number, can be recoded only as of STAR DIAGNOSIS Update 02/03 (read coding and change if required).	AR54.21-P-1260T

**Parts ordering notes**

Part no.	Designation	Quantity
A 211 545 40 01	SAM control unit with fuse and relay module (N10/1)	1