



DTB

Date: May 11, 2009
 Order No.: P-B-28.50/10a
 Supersedes: P-B-28.50/10 dated July 28, 2008
 Group: 28

Revision History

Revision	Date	Purpose
a	5/11/09	VIN Added (X224020)
-	7/28/08	Initial issue

SUBJECT: Model 211.090, Up to VIN B332016 or X224020
Vibration and/or Chatter from Powertrain While Making Small Radius Turns at Low Speeds

If you receive customer reports in the above model vehicle of vibrating and/or chattering from the powertrain while making small radius turns at low speeds, this can be caused by changes to the friction coefficient of the clutches in the center differential. To resolve, replace the transfer case. Refer to WIS AR28.10-P-0100T.

Parts Information

Qty.	Part Name	Part Number
1	Transfer case	A211 280 10 00

i **Note:** The following allowable labor operations should be used when submitting a warranty claim for this repair. This information has been generated on July 28, 2008. Please refer to Netstar → Star TekInfo → Star Time for the most current labor time allowance.

In Case of Warranty

Operation: Compartment panel, bottom – rear part, R&R (61-0172)
 Transfer case, R&R (28-2010)

Damage Code	Operation Number	Time (hrs.)	Model Indicator (s)
28258 H4	61 0172	0.2 hrs.	TA
	28 2010	3.2 hrs.	TA

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.