



**DTB**

Date: April 5, 2005  
 Order No.: P-B-88.50/40  
 Supersedes:  
 Group: 88

**SUBJECT: Model 211.026/056/065/070/076/082/083/087 with code 881 (Remote Trunk Closing)  
 All Model Years  
 Trunk Lid Opens or Closes Too Quickly While Operating with Remote Trunk Lid  
 Control Button**

If you receive customer reports in the above model vehicles that the trunk lid opens or closes too quickly while operating the remote trunk lid control switch on the driver's door (S15/1), a revised trunk lid control module (TLC) may be required.

**i** **Note:** Typical time to open the trunk is approximately 2 seconds. Typical time to close the trunk is approximately 3 seconds. Do not replace any parts if vehicle in question's time to open or close is equal to or greater than above times.

To resolve, replace the trunk lid control module (N121) with the revised part listed below as per WIS document AR88.50-P-5300T.

**Parts Information**

Qty.	Part Name	Part Number
1	Trunk Lid Control Module	A211 870 30 26 **

**\*\*Parts are in a critical supply situation and will be limited, please see the PAC weekly status report on parts availability status and delivery expectations. This report is located on the PAC website.**

**i** **Note:** The following allowable labor operations should be used when submitting a warranty claim for this repair.

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

**In Case of Warranty**

**Operation:** Ground cable – electrical system battery, D&C (54-7989)  
(when separating electrical connectors)  
Control unit – remote trunk lid closing (after test), replace (80-2055)

<b>Damage Code</b>	<b>Operation Number</b>	<b>Time (hrs.)</b>	<b>Model Indicator (s)</b>
53234 52	54 7989	0.3 hrs.	T1, T2, T3, T4, T5, T6, T7, T8
	80 2055	0.4 hrs.	T1, T2, T3, T4, T5, T6, T7, T8