



DTB

Date: February 8, 2007
Order No.: P-B-68.50/27d
Supersedes: P-B-68.50/27c dated Jan. 31, 2007
Group: 68

Revision History

Revision	Date	Purpose
d	2/8/07	Part Number Updated for Rear SAM
c	1/31/07	Remedy Updated
b	5/23/06	Remedy Updated
a	1/31/05	Remedy Updated
-	8/25/04	Initial issue

SUBJECT: Model 211.256/265/276/282/283/287
Load Compartment Cover Does Not Rise When Opening Tailgate

If you receive customer reports in the above model vehicles that the load compartment cover does not rise when opening the tailgate, this may be due to a software error in the rear SAM or the drive unit is sticking in the lower end position. First check if the load compartment cover motor is being energized.

1. Open tailgate.
2. Unhook load compartment cover from guide rails and roll cover up.
3. Place hand on headliner in the area of the motor mount (Figure 1) and simultaneously lock and unlock tailgate lock pawl using a screwdriver. If the motor is being energized, a distinct movement can be felt. If there is no movement, proceed to step 7.
4. If a distinct movement is felt, the drive mechanism is stuck.
5. In this case:
 - a. For vehicles up to VIN B014421 or VIN X21300, replace (WIS document AR68.30-P-1100T) left and right guide rails with part numbers A211 810 05 27 and A211 810 06 27, respectively.
 - b. For vehicles as of VIN B014421 or VIN X21300, it is only necessary to relieve the stress in the system. Remove and reinstall the guide rails. Do not install new guide rails.
6. Reattach load compartment cover and check for correct function.
7. Expose rear SAM (N10/2). Refer to WIS document AR54.21-P-1258TA.
8. If vehicle is equipped with rear SAM part number A211 545 21 01 or A211 545 22 01, install new control units as of HW 03/04 and SW 10/03.

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

