



MODEL 211.2 except CODE (489) AIRmatic (semi-active air suspension)

MODEL 211.6

- 1 Rear seat cushion
- 2 Felt casing
- 3 Pressure line connector
- 4 Pressure lines

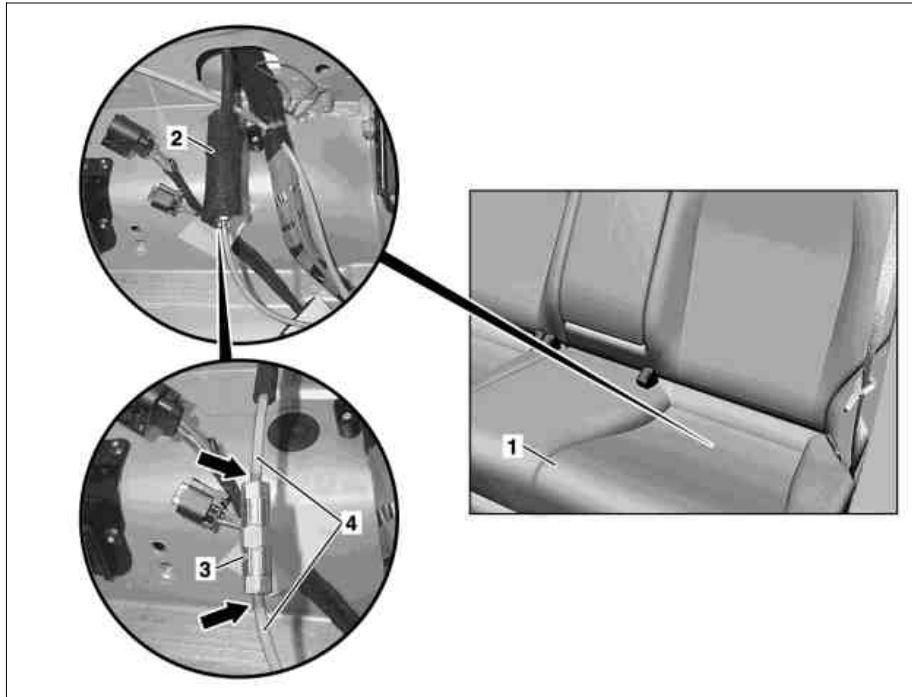

P32.22-2265-06

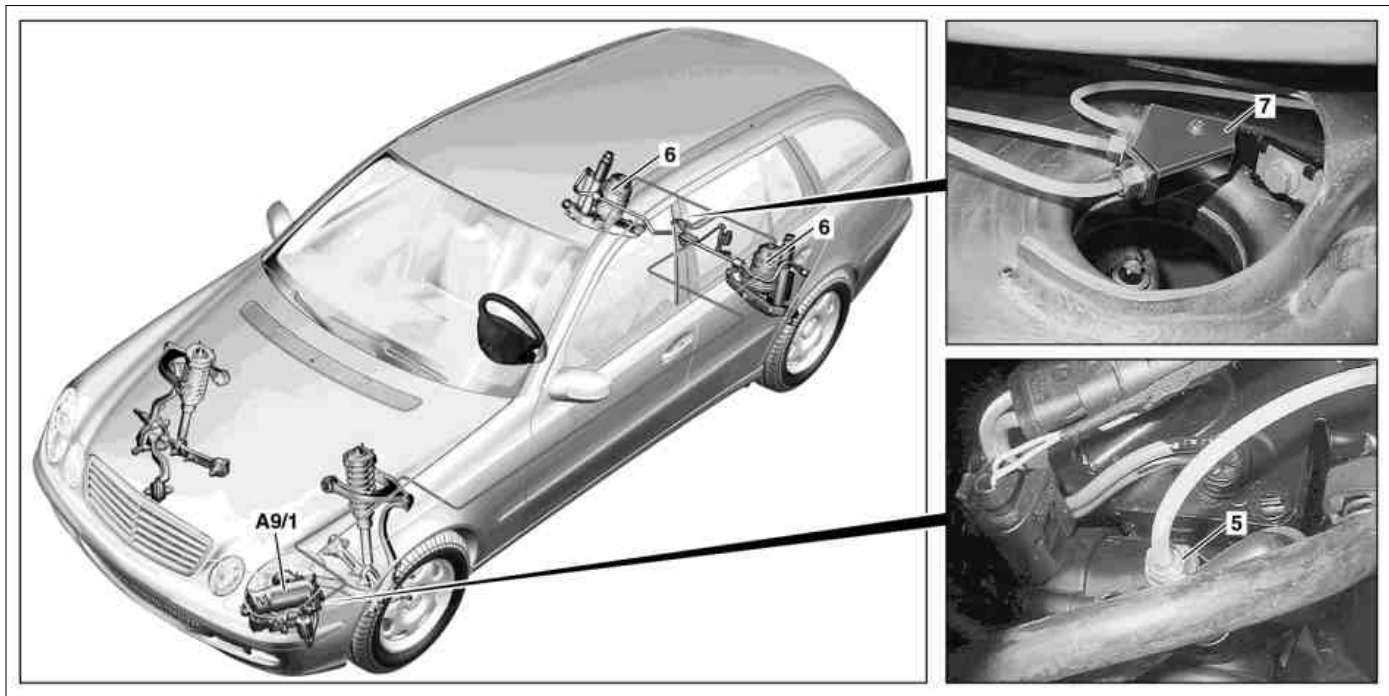

P32.22-2264-09

- 5 Pressure line connection
- 6 Air suspensions

7 Rear axle distributor unit

A9/1 AIRmatic compressor unit

| | | | |
|-----|--|---|------------------------------------|
| | Check | | |
| | Notes on air suspension | | AH32.22-P-1000-01T |
| 1.1 | Fold left rear seat cushion (1) as per front | Model 211.2, see: ↓ Remove rear seat cushion.* | AR91.12-P-1020TB |
| 2 | Remove felt wrapping (2) from pressure line connector (3) and check if pressure lines (4) are inserted up to markings (arrows) in pressure line connector (3). | | |

| | | | |
|-----|--|---|--------------------|
| 3 | Spray leak detection spray onto pressurized line connection fitting (3) | <p>i Wait approx. 10 to 15 minutes after spraying. Minor leakages can be detected as a result (formation of a foam crown). Larger leaks are visible immediately. If pressurized line connection fitting is defective:</p> <p style="text-align: center;">↓</p> <p>Repair supply line connection for air suspension.</p> <p>i Installation: Attach felt casing (2) again after completing the leak test .</p> | AR32.22-P-2001-01T |
| 4.1 | Remove front section of bottom section of soundproofing | Vehicles with diesel engines | AR94.30-P-5300T |
| 4.2 | Remove front section of engine compartment paneling | Vehicles with gasoline engines | AR61.20-P-1105T |
| 5 | Spray leak detection spray onto pressurized line connection fitting (5) on AIRmatic compressor unit (A9/1) | <p>i Wait approx. 10 to 15 minutes after spraying. This allows smaller leaks to be detected (bubbles form). Larger leaks are visible immediately. If pressurized line connection fitting is defective:</p> <p style="text-align: center;">↓</p> <p>Repair supply line connection for air suspension.</p> | AR32.22-P-2001-01T |
| 6 | Spray leak detection spray onto the air spring (6) and the rear axle distributor unit (7) | <p>i Wait approx. 10 to 15 minutes after spraying. This allows smaller leaks to be detected (bubbles form). Larger leaks are visible immediately. If pressurized line connection fitting is defective:</p> <p style="text-align: center;">↓</p> <p>Repair supply line connection for air suspension.</p> | AR32.22-P-2001-01T |