
212 MY2013 and MY2014 - Harsh Shifts: 4-3, 4-5

Topic number	LI27.19-P-056610
Version	4
Design group	27.19 Transmission - electrical system
Date	10-31-2013
Validity	Only for 212 with M276 experiencing harsh 4-3 4-5 complaints
Reason for change	Changed Validity

Complaint:

Harsh 4-3 and/or 4-5 shifts may be experienced, usually more noticeable with light throttle drivers. No check engine light etc. or related diagnostic fault codes. Adaptation values are usually within specification.

Cause:

System software can adapt poorly under certain driving conditions

Remedy:

Flash transmission control unit using Star Diagnosis with the following add-ons:

Model Year 2013: Add-on 3138 for DVD 07/2013, add-on 3139 for DVD 09/2013 or newer

Model Year 2014: Add-on 3170 for DVD 09/2013 or newer

After flashing, perform adaption on transmission

Symptoms
Power transmission / Automatic transmission / Automatic transmission - function / Shifting is rough