

Deformation of engine compartment soundproofing

Topic number	LI62.25-P-056043
Version	1
Design group	62.25 Fire wall
Date	06-05-2013
Validity	Model series 212 and 218
Reason for change	

Complaint:

Engine compartment soundproofing parts separate from body structure (Figure 1, Figure 2, and Figure 3)

Attachments	
File	Designation
Bild 1.jpg	Overview of protruding engine compartment soundproofing parts
Bild 2.jpg	Left soundproofing part
Bild 3.jpg	Soundproofing on major assemblies compartment partition

Cause:

Deformation due to water ingress

Remedy:

Remove engine compartment seal above the soundproofing and exchange for a seal with a longer sealing lip (A212 628 08 00).

When installing the optimized seal, push the deformed soundproofing parts under the longer sealing lip.

Symptoms
Body / Body/Cab / Body / Surface warp

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 212 628 08 00			Seal	1	Seal with lengthened sealing lip	X	