

	<b>Remove/install</b>		
<b>Danger !</b>	<b>Risk of death</b> caused by contact with parts conducting high voltages.	Do not touch parts which conduct high voltages. Persons who have electronic implants (e.g. cardiac pacemakers) should never perform any work on the ignition system.	AS15.10-Z-0001-01A
<b>Danger !</b>	<b>Risk of injury</b> . Skin or eye injuries may result when handling hot or glowing objects.	Wear protective gloves, protective clothing and safety glasses, if necessary.	AS00.00-Z-0002-01A
	Notes on avoiding damage through contamination and foreign objects		AH00.00-P-5000-01A
	Notes on avoiding damage to ignition system		AH15.10-P-0002-01V
1	Switch off ignition		
2	Open engine hood		
3	Remove ignition coils	Model 207 except engine 276, 278 Model 212 except engine 157, 276, 278 ENGINE 276, 278 in MODEL 207 ENGINE 157, 276, 278 in MODEL 212, 218	AR15.12-P-2003CV AR15.12-P-2003EW AR15.12-P-2003FH AR15.12-P-2003EL
4	Detach spark plug connectors (1) from spark plugs (R4)	ENGINE 272.982/983/984 <b>Installation:</b> Observe correct assembly of spark plug connector and ignition coil connector (1, 3) and correct routing of ignition lines (4). Puller	AR15.12-P-1010-01CDE  *272589013300
	<b>Check</b>		
5	Check spark plug connector (1)	Check for damage, deformation and crack formation, replace if necessary.	
6	Check ignition coil plug (3) and ignition lines (4)	ENGINE 272.982/983/984 Check for damage, deformation and crack formation, replace if necessary.	
7	Remove spark plugs (R4) from the cylinder heads using spark plug wrench (01)	<b>Installation:</b> It is essential to adhere to the tightening torque as it influences the position of the spark plug electrodes in the cylinder. An incorrect tightening torque causes misfires which can lead to damage to the engine and catalytic converter damage Spark plug to cylinder head Motor 272, 273 Spark plug wrench Motor 157, 276, 278 Spark plug wrench	*BA15.10-P-1001-01C *112589010900 *278589000900
8	Install in the reverse order		