

---

## Torque converter drain plug not aligned with drain plug access in bell housing

---

Topic number	LI27.20-P-061496
Version	1
Design group	27.20 Torque converter
Date	05-21-2015
Validity	All vehicles with M276 and transmission 722.9
Reason for change	

---

### Complaint:

Torque converter cannot be drained due to misalignment of drain plug and access hole in bell housing

Attachments	
File	Description
Misaligned.jpg	Drain plug misalignment

### Cause:

Change in production to bell housing. This is a production change not a defect. This is not cause for a Warranty claim.

### Remedy:

Open and close the drain plug from a side access hole in the transmission. Fluid will drain through the normal drain hole. Following draining, be sure to clean transmission fluid that has ended up inside the bell housing.

Attachments	
File	Description
torque converter housing.JPG	Access through side of housing