

Keyless-Go completely inoperative

Topic number LI80.61-P-057752

Version 1

Design group 80.61 Keyless-Go / Keyless-Entry

Date 11-18-2013

Validity Model series 212 and 222, vehicles with code 889 (Key-

less-Go)

Reason for change

Complaint:

Vehicle cannot be opened/closed or started via Keyless-Go.

Cause:

The vehicle key was fitted with the wrong processor at the manufacturer. Therefore no Keyless-Go communications are possible between the key and the vehicle.

Only vehicles within the following VIN ranges are affected.

Model series 212: VIN from A909083 to A920630.

Model series 222: VIN from A020500 to A023037.

Remedy:

Verify whether the Keyless-Go function in the vehicle has worked in the past!

If YES:

Press button on key

- Keyless-Go function is restored: Do not replace any parts!
- Keyless-Go function inoperative: Perform Keyless-Go diagnosis with XENTRY

If NO:

Press button on key repeatedly. If the Keyless-Go function is still not restored after this, replace the affected key. Perform the function test with both keys!

Symptoms

Overall vehicle / Safety and locking system / Keyless go / Keyless go function / Vehicle does not open

Overall vehicle / Safety and locking system / Keyless go / Keyless go function / Vehicle does not close using door handle

Overall vehicle / Safety and locking system / Keyless go / Keyless go function / Start/stop switch nonfunctional

