AR07.03-P-1010-02MMA	Mount high-pressure lines.	

Engine 276

Modification notes

24.09.2014	Union nut, fuel line to diagnostic socket	BA07.03-P-1008-01D
24.09.2014	Union nut, fuel line to high-pressure pump	BA07.03-P-1002-01D
24.09.2014	Union nut, fuel line to fuel distributor	BA07.03-P-1001-01D

Nm Injection nozzles, injection valves, lines

Number	Designation			Engine 276
BA07.03-P-1001-01D	Union nut, fuel line to fuel distributor	Stage 1	Nm	15
		Stage 2	۲°	90

Nm Injection nozzles, injection valves, lines

Number	Designation			Engine 276
BA07.03-P-1002-01D	Union nut, fuel line to high-pressure pump	Stage 1	Nm	15
		Stage 2	۲°	90

Nm Injection nozzles, injection valves, lines


Number Designation		Engine 276	
BA07.03-P-1003-01D	Screw/bolt, fuel line service connection to cylinder head cover N	١m	9

Nm Injection nozzles, injection valves, lines

Number	Designation		Engine 276
BA07.03-P-1005-01D	Screw/bolt, fuel line clamps	Nm	9

Nm Injection nozzles, injection valves, lines

Number	Designation			Engine 276
BA07.03-P-1008-01D	Union nut, fuel line to service connection	Stage 1	Nm	15
		Stage 2	४°	90

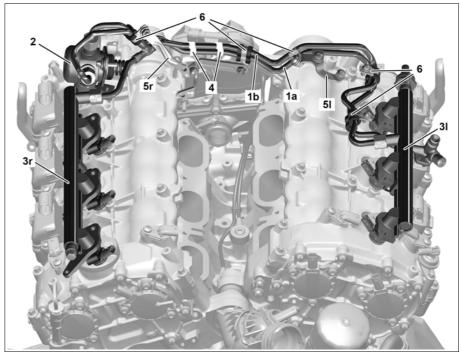

P07.03-2295-06

(b) The union nuts for the low-pressure line (1a) and high-pressure line (1b) may only be tightened with a torque after installation of the low-pressure line (1a) and high-pressure line (1b).

Leaks can occur otherwise.

() Do not kink or bend low-pressure line (1a) and high-pressure line (1b). Leaks can occur otherwise.

- 1 Loosely mount low pressure line (1a) on high-pressure pump (2) and on the left cylinder head cover.
- 2 Loosely mount high-pressure line (1b) on left rail (1l) and right rail (1r) and on high-pressure pump (2).
- 3 Mount clamps (6) for lowpressure line (1a) and the highpressure line (1b) on the cylinder head covers №m.


i Clamps (6) must be aligned before screwing on. Pay attention to correct routing of the low-pressure line (1a) and the high-pressure line (1b).

4 Tighten union nuts with torque

Comply with the tightening torques exactly. Leaks can occur otherwise.

Shown on engine 276.8

Engine 276

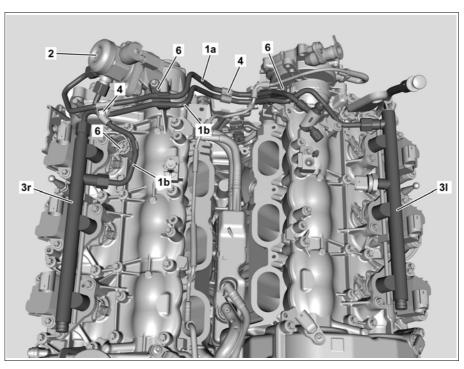

P07.03-2373-06