
Opening via radio remote control or Keyless-Go and/or Keyless Start intermittently inoperative

Topic number	LI80.61-P-060558
Version	2
Design group	80.61 Keyless-Go / Keyless-Entry
Date	01-07-2015
Validity	246, 176, 156, 212, 207, 218, 166, 117, 231, 242 with code 893, 889 or P17 205 with code 893, 889 or P17 222, 217
Reason for change	Better description of issue needed.

Complaint:

Vehicle intermittently cannot be opened via Keyless-Go.

Vehicle intermittently cannot be started via Keyless-Go.

Vehicle intermittently cannot be opened via radio remote control (FFB).

Keyless-Go completely inoperative.

(Keyless-Go control unit is off line, and missing from the Quick Test. It will come back online if power is reset.)

Cause:

Faulty software in Keyless-Go control unit

Affected software numbers:

A 212 902 83 06

A 222 902 16 08

Remedy:

Install latest Keyless-Go software in control unit.

(The Keyless-Go control unit may need to be reset by removing power prior to installing the software)

This is available with:

Add-on 4160 for DVD 09/14

Add-on 4161 for DVD 12/14

Work units				
Op. no.	Operation text	Time	Damage code	Note
54-0991	CONTROL UNIT ... INSTALL SOFTWARE (AFTER QUICK TEST)		82190 90	