

## Passenger seat adjustment when rear seat is folded down

Topic number	LI91.10-P-052336
Version	1
Design group	91.10 Front seats
Date	08-17-2011
Validity	All model 212 vehicles
Reason for change	

### Complaint:

After folding down the right rear seat, the customer cannot adjust the front passenger seat to a comfortable position. The backrest is angled too far forward.

### Cause:

This is a normal setting from the factory. Originally, this was put into place to ensure the rear head rest would not interfere with the Weight Sensing System in the passenger seat. Now with the new bladder Weight Sensing System, this function is no longer necessary and can be disabled safely.

### Remedy:

In Xentry, navigate to the following menu:

ESA 'Front Passenger' - Electric seat adjustment 'Front passenger' (N32/2) -> Adaptations -> Configuration -> Manual Settings -> Seat adjustment

Set the coding "Adjustment range limitation for preventing collision with rear seat" to "nicht aktiv"

Attachments	
File	Designation
Xentry menu.jpg	Path to get to coding to change the parameters in the ESA

Symptoms
Seat / Body / Seat adjustment / Does not adjust aft /
Seat / Body / Seat adjustment / Does not adjust fore /