

Window lifter reverses direction

Topic number	LI72.40-P-065822
Version	1
Design group	72.40 Door control
Date	02-28-2017
Validity	MODEL 213
Reason for change	

Complaint:

Window lifter reverses direction on reaching upper end position.

Cause:

Software adjustment in door control unit (DCU-xx).

Remedy:

Remedy in preparation.

Until a remedy is available, when a problem arises, the power window system should first be denormalized per Xentry Diagnostics (XD) and then normalized again.

The power window system must then undergo teach-in by completely opening and closing the side window pane twice "manually" (press power window switch to 1st notch only).

Note: Replacing parts does not remedy the complaint

Control unit/fault code		
Control unit	Fault code	Fault text
N69/1 - Left front door (DCU-LF) (DMFL213)	-	-
N69/2 - Right front door (DCU-RF) (DMFR213)	-	-
N69/3 - Left rear door (DCU-LR) (DMRL213)	-	-
N69/4 - Right rear door (DCU-RR) (DMRR213)	-	-

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note

XENTRY TIPS

			72220 GR	
			72230 GR	
			73A30 GR	
			73N30 GR	