

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2016110007, January 2017

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model 213, Model Year 2017**
Activate (Teach-In) Headlamp Control Module

Daimler AG, the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY17 model 213 vehicles, the curve illumination and cornering lights may be inactive due to a setting in the headlamp control module. An authorized Mercedes-Benz dealer will activate the curve illumination and cornering lights function in the affected vehicles.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 3866 vehicles are affected.

Order No. P-SC-2016110007

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin


Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

i Note:

- Use DAS/Xentry 12/16 with all associated patches or higher.
- Follow the steps exactly as described in DAS/Xentry.
- Connect battery charger (battery voltage  >12.5V).
- Ensure all electrical consumers are switched-off.
- In the event of software/SCN update issues, contact Star Diagnosis User Help Desk. Please refer to the “pre-call” check list before contacting UHD
- Refer to Star Diagnosis System (SDS) Best Practices Guide.

1. Switch on ignition and set light switch to automatic.

i Note:

Manually close both hood locks (do not close hood).

2. Teach in left headlamp control unit (SG-SW-L): Control units view ➡ Body ➡ SG-SW-L ➡ Left headlamp ➡ Adaptations ➡ Teach-in processes ➡ Adaptation data ➡ ILS activation.
3. Follow on-screen instructions.

i Note:

Remember to pull hood release handle in order to open hood locks prior to closing hood.

i Note:

The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Connect/disconnect battery charger (02-5058)
 Star Diagnosis System (SDS), Connect/disconnect (02-4762)
 Activate (teach in) headlamp control module (02-9727).

Damage Code	Operation Number	Labor Time (hrs.)
82 918 43 8	02-5058	0.1
	02-4762	0.1
	02-9727	0.1

i Note

Operation Number labor times are subject to change.