## Noticeable Vibrations At The Steering Wheel

Topic number Version Function group Date	LI46.35-P-073051 1 46.35 - Electrical steering 6/3/21
Validity	Model 253, from manufacturing date 01.03.2020 Model 293, from manufacturing date 01.03.2020 Model 205 with code M005 from manufacturing date 01.03.2020 Model 213 with code M005 from manufacturing date 01.03.2020 Model 238 with code M005 from manufacturing date 01.03.2020 Model 257 with code M005 from manufacturing date 01.03.2020
Reason for change	

### Complaint

Noticeable vibrations at the steering wheel:

- At speeds between 40mph and 75mph
- On straight stretches of road and in long corners
- With driver assistance systems switched on

#### Cause

Control oscillations in the electric power steering.

• Complaint only occurs with software 2389029205 (other software releases not affected)

#### Remedy

Perform software update of electric power steering (N68).

Note: Please ensure newest Xentry release software is installed and all addons are updated.

Sympto	ms				
Power tra	nsmission > Drive shaft > Prop	eller shaft > Function > \	/ibration/out-o	of-balance	
Power tra	nsmission > Drive shaft > Axle	shaft > Function > Vibra	tion/out-of-ba	lance	
Chassis/s	uspension > Wheels/tires > Ti	re properties > Vibration/o	out-of-balance	e	
Chassis/s	uspension > Steering system :	> Steering wheel > Vibrat	es		
Chassis/s	uspension > Steering system >	> Steering wheel > Pulses	s		
Operatio	on numbers/damage code	es			
Op. no.	Operation text	Time	Damage code	Note	

# XENTRY TIPS

control unit - Software release
---------------------------------

