


Close holes (1, 2, 3) with plugs

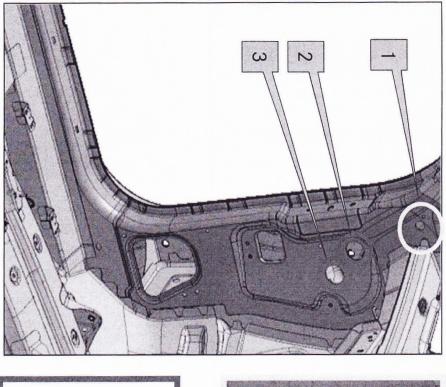


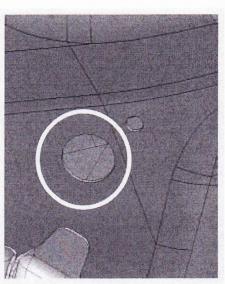

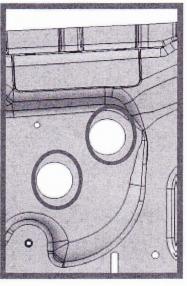





Close holes (4, 5, 6, 7, 8) with tape A 006 989 30 85

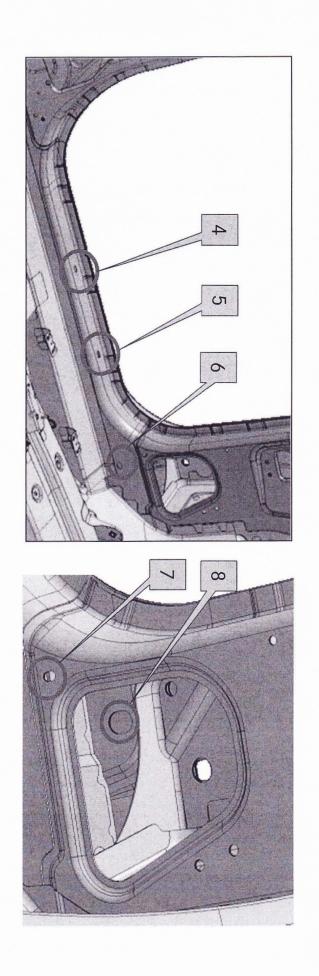


Close hole (9) with sealing A 005 989 6320

Skin paneling side panel
A-pillar reinforcement inside

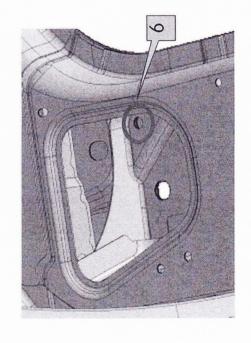

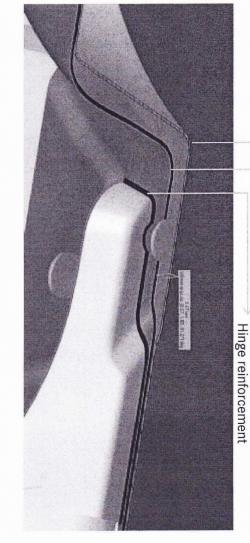



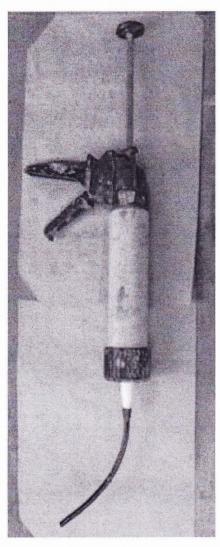


until the cavity between the panels is completely filled. Lead hose through the hole (9) to the skin paneling side panel. Pull out the hole slowly and apply sealing material


Close hole (10) with sealing A 005 989 6320


Skin paneling side panel


A-pillar reinforcement inside

Hinge reinforcement

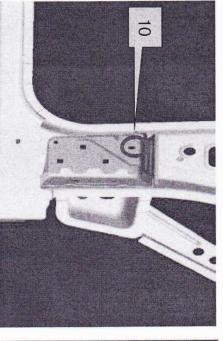

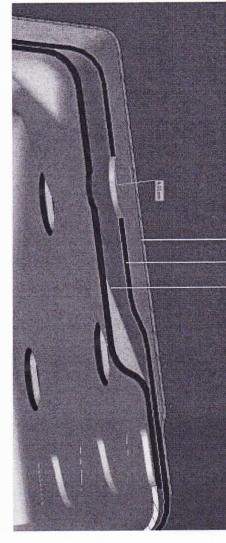

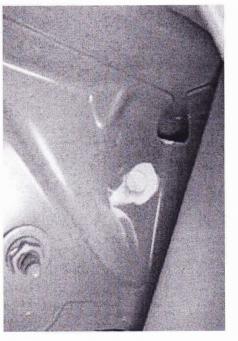

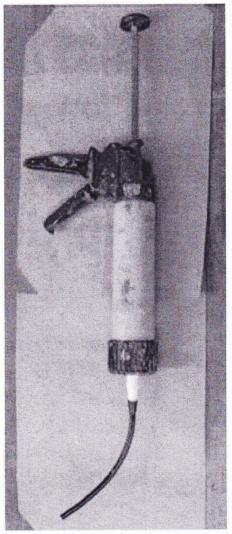

until the cavity between the panels is completely filled. Lead hose through the hole (10) to the skin paneling side panel. Pull out the hole slowly and apply sealing material