
VIN	4JGBB86E68A308649	Model series/model designation	164.186
Order number		License plate	

Check component E1e6 (Left side marker lamp).

The actuation of component E1e6 (Left side marker lamp) was not OK.
There are current fault codes present.

i **Note :**

- If current fault code exists, no voltage measurement is possible (control module switches off output).

Preconditions :

- The light sources and lamp carriers are OK.
- The power supply of component N10 (Front SAM control unit) is OK.

Possible cause and remedy :

- Test cable (N10) C.36 - 1.D1 (X25/2) for Short circuit or open circuit, repair or replace if necessary.
- Test cable (X25/2) 1.D1 - S5.2 (E1e6) for Short circuit or open circuit, repair or replace if necessary.
- Test cable (E1e6) S5.1 - (W9) for Short circuit or open circuit, repair or replace if necessary.
- Component N10 (Front SAM control unit) is defective.

i **Note:**

Connector arrangement at control unit with key F7

End of test

Filename: F:\Programme\DAS\bin\..\trees\pkw\grundmod\samv3\ps\ps_e1e6.s
Cell co-ordinate: 21 , 27