
ENGINES 642 in MODEL 164, 251

- 1 Screw
- 2 Engine charge air duct at turbocharger

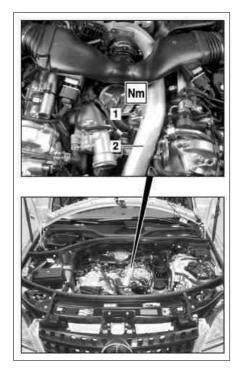

P09.41-2380-03

XX	Remove/install		
	Risk of injury caused by fingers being	Keep body parts and limbs well clear of	AS00.00-Z-0011-01A
	pinched or crushed when removing, installing or aligning hoods, doors, trunk lids, liftgates or sliding roof	moving parts.	
1	Removes strut tower brace	Model 164.8 only	AR62.30-P-2500GY
		i Remove strut tower brace from strut tower	
		mounts.	
2	Remove engine cover	Model 164	AR01.10-P-2405GZB
		Model 251	AR01.10-P-2405RTB
3	Remove engine charge air channel upstream of charge air cooler		AR09.41-P-8623GZB
4	Remove bolt (1)	Nm	*BA09.41-P-1001-01J
5	Loosen coolant hose from bracket	Engine 642.8	
6	Remove engine charge air channel at turbocharger (2) towards the front	i Installation: Check sealing rings and replace if necessary.	
7	Install in the reverse order	•	

Nm Charge air pipe/charge air cooling

Number	Designation	Engine 642
BA09.41-P-1001-01J	Bolt, engine charge air channel of Nm turbocharger to charge air manifold	12