

540992 CONTROL UNIT- CODE (AFTER SHORT TEST), PERFORM 916 W67 (N/C)
 541012 TEST PROGRAM - AFTER SHORT TEST, PERFORM (PRINTOUT REQUIRED) 916 W67 (N/C)
 540992 CONTROL UNIT- CODE (AFTER SHORT TEST), PERFORM 916 W67 (N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

590 CODING FAULT IN INSTRUMENT CLUSTER W.-PERFORMED SDS SHORT TEST, NO CODES STORED. CONNECTED BATTERY CHARGER TO MAINTAIN SYSTEM VOLTAGE. FOUND THAT AMBIENT LIGHTS IN BOTH MIRRORS ARE NOT COMING ON. PERFORMED SCN CODING OF EIS AND FUNCTION TESTED LOCATOR LIGHTING, STILL NOT WORKING. CHECKED BOTH DOOR CONTROL MODULES FOR NEWER SOFTWARE (NONE AVAILABLE) AND PERFORMED SCN CODING. CHECKED FUNCTION OF LIGHT SENSOR IN OCP ACTUAL VALUES, WORKING PROPERLY. CHECKED INSTRUMENT CLUSTER FOR NEWER SOFTWARE (NONE AVAILABLE) AND PERFORMED SCN CODING. RECHECKED FUNCTION OF LOCATOR LIGHTING AND IT IS NOW FUNCTIONING PROPERLY.

B Q.C. DOCUMENTATION - EXPRESS SERVICE


STATEMENT OF DISCLAIMER

LIMITED WARRANTY

The only warranties applying to the part(s) installed in accordance with this repair order are those that may be offered by the manufacturer. The Seller hereby expressly disclaims all warranties including any implied warranty of merchantability or fitness for a particular purpose. No employee of the seller or other person is authorized to alter or modify in any way any provisions of this disclaimer.
 I hereby acknowledge receipt of a copy hereof.

Customer Signature

X

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS	
SALES TAX	
PLEASE PAY THIS AMOUNT 	

CUSTOMER COPY