

CUSTOMER #: 87712

214449

MERCEDES-BENZ of FORT MYERS

INVOICE

15461 S. TAMiami TRAIL
FORT MYERS, FL 33908
(239) 433-8300
(239) 433-8302

FORT MYERS, FL 33913-6702

PAGE 1

SANDY@COMN339@GMAIL.COM

BUS:

CELL:239-236-7721

SERVICE ADVISOR: 20019 CODY CLEMONS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	15	MERCEDES-BENZ TR ML3	4JGDA2EB7FA459660		44846/44884	T3480	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
02JAN17 DD			18:00 20FEB18		0.00	CASH	21FEB18
R.O. OPENED		READY	OPTIONS:				
09:42 20FEB18		14:07 21FEB18					

LINE OPCODE TECH TYPE HOURS

LIST NET TOTAL

A CLIENT STATES CHECK ENGINE LIGHT IS ON

CAUSE: F

495958 REPLACE NOX SENSOR DOWNSTREAM OF SCR
CATALYTIC CONVERTER

2295 W67

(N/C)

1 000-905-35-03 NOX SENSOR

(N/C)

1 000-905-36-03 NOX SENSOR

(N/C)

541011 PERFORM QUICK TEST

2295 W67

(N/C)

540650 ON-BOARD POWER SUPPLY VOLTAGE MAINTAIN

(WHEN CHECKING/ TESTING AND TROUBLESHOOTING)

2295 W67

(N/C)

495956 REPLACE NOX SENSOR UPSTREAM OF SCR

CATALYTIC CONVERTER

2295 W67

(N/C)

470643 SEPARATE PARTS FOR ADBLUE SYSTEM:

..... AS PER FAULT CODE CHECK

2295 W67

(N/C)

009151 PERFORM TEST DRIVE REASONING:

TECHNICIAN: DEPARTURE: ARRIVAL:

..... KM/MI AT START:

2295 W67

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A:

0.00

44884 NOX SENSOR FAULTS AND EXHAUST AFTERTREATMENT TEST NOT
COMPLETEDCONNECT BATTERY CHARGER PERFORMED SDS QUICK TEST FOUND FAULTS IN
CDI FOR NOX SENSOR IMPLAUSIBLE VALUES/ START COUNTER ACTIVATED
/MALFUNCTION OF ADBLUE SYSTEM

PROCESS FAULT AS PER SDS REPLACED NOX SENSORS RELEARN NEW SENSORS

UPDATE CDI AND SCR MODULES AS PER SDS PERFORMED EXHAUST AFTER TREATMENT

TEST WHILE DRIVING TIME OUT 8:36 MILES OUT 44846 TIME IN 9:47 MILES IN

44884 TEST RESULT SUCCESSFUL AS PER SDS PROCESS THE OTHER FAULT RESET

START COUNTER AND CLEARED FAULT ALL WORKING AS DESIGNED CHECK ENGINE

LIGHT OFF

PLEASE SEE THE LIMITED WARRANTY ON THE REVERSE SIDE OF THIS
REPAIR INVOICE.SHOP SUPPLIES AND HAZARDOUS MATERIALS CHARGES: We have added
a charge equal to 15% of the cost of parts & labor up to a maximum of
\$100.00. "This charge represents costs and profits to the motor repair
facility for miscellaneous shop supplies or waste disposal." [s.559.905 (l) (h)]The State of Florida requires a \$1.00 fee to be collected for each new tire
sold in the state [s.403.718], and a \$1.50 fee to be collected for each new
or remanufactured battery sold in the state, [s.403.7185].

X

CUSTOMER SIGNATURE

PAYMENT METHOD

CASH AMERICAN EXPRESS
CHECK VISA
DISCOVER MASTERCARD
INTERNAL OTHERSTATE OF FLORIDA
REGISTRATION NUMBER
#MV - 38724

DESCRIPTION

LABOR AMOUNT
PARTS AMOUNT
GAS, OIL, LUBE
SUBLET AMOUNT
MISC. CHARGES
TOTAL CHARGES
LESS INSURANCE
SALES TAX
PLEASE PAY
THIS AMOUNT

TOTALS

ALL PARTS INSTALLED ARE NEW UNLESS OTHERWISE INDICATED