

2-3 upshift slips once

Topic number LI27.00-P-048552

Version 3

Design group 27.00 General

Date 04-06-2010

Validity Transmission 722.9 with engines 273, 272 and 642

Reason for change Remedy revised and M272 included

Reason for block

Complaint:

After a cold start, slippage may occur in the 2-3 shift when the vehicle moves off for the first time.

Cause:

A basic charge for the K1 piston is not guaranteed with a cold start. The plate pressure still has to be built up. This can cause the shift operation to slip once.

Remedy:

Topic is known. A software improvement is being produced. Replacing hardware does not resolve the issue.

Software for M273 is published with DVD 01/2010.