




You can see here
that the cap has
sheared.

Drilled these two rivets out.

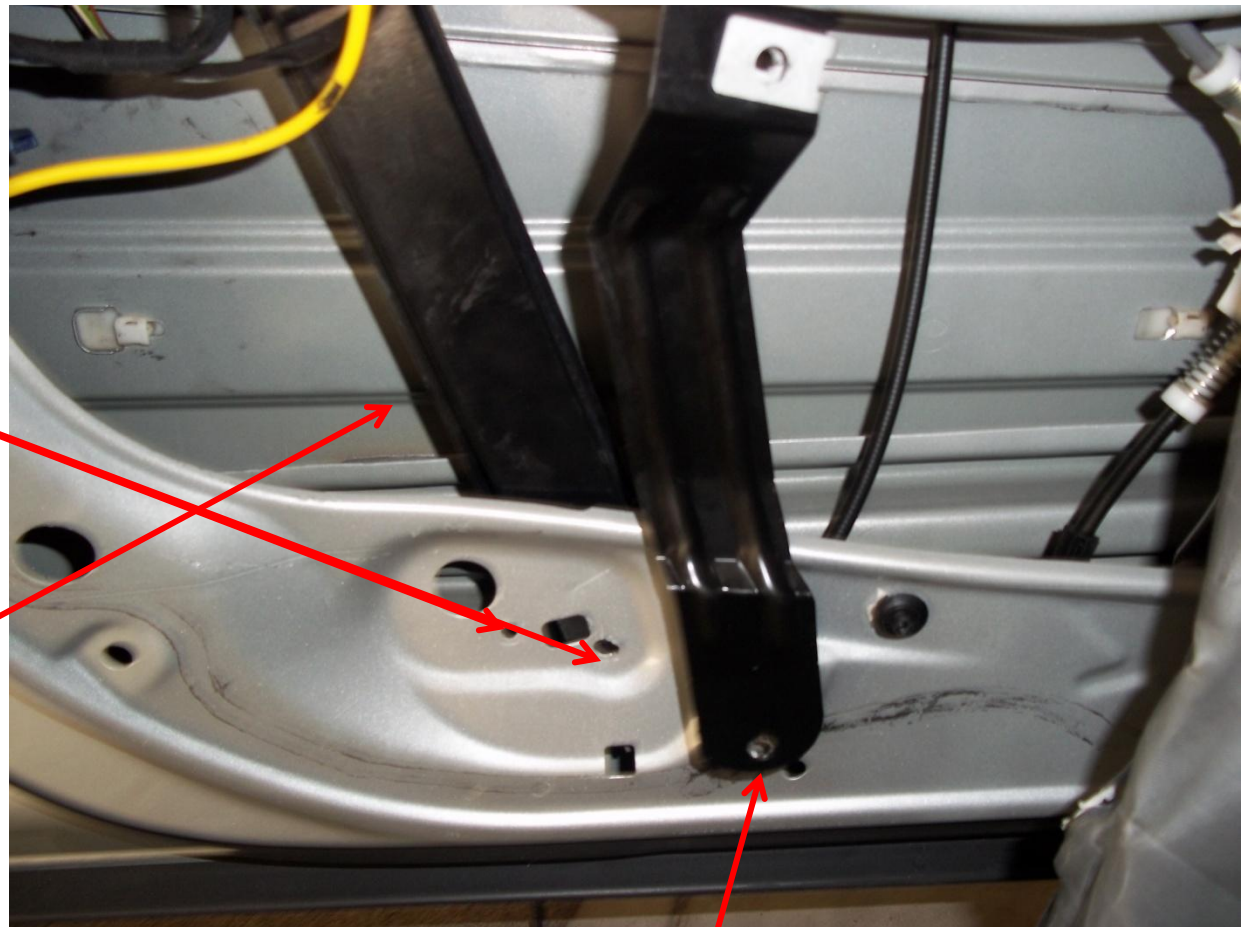

Once the two rivets are out and the *guard rail* rivet is drilled out, you can move this bar just enough to the right to get the actuator out. **DO NOT** try and force this rail more than you need.

The part number for the rivet is 003-990-24-97
Personally I would not use aluminum rivets. MB sells these rivets for about \$1.50 each. I did not put the rivets back in yet. Will do so after everything works.

Also drilled out this *guard rail* rivet. This will allow you to move the bar out of the way.