



- 1 Remove glove compartment lamp (E13/1) from glove compartment (4).

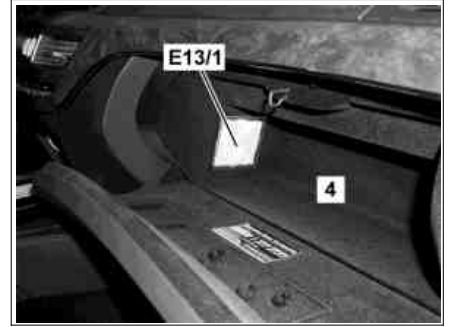


P82.60-5468-01

- 2 Remove damping material (8) in the area (A) from rear of glove compartment (4).
- 3 Check whether no other components or wiring harnesses are installed in area (A) on rear of glove compartment (4).

i Drill hole in area (A).

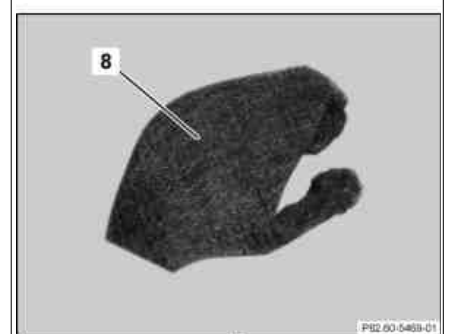

P82.60-5469-01

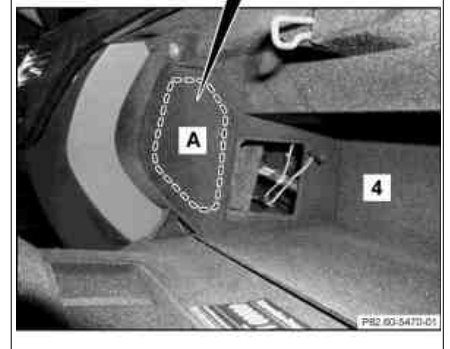


P82.60-5470-01

- 4 Drill hole (C) with $\varnothing = 20$ mm into glove compartment (4) as per the dimensioning.


! Ensure that no other components are damaged when drilling hole (C).

$B=15\text{mm}$

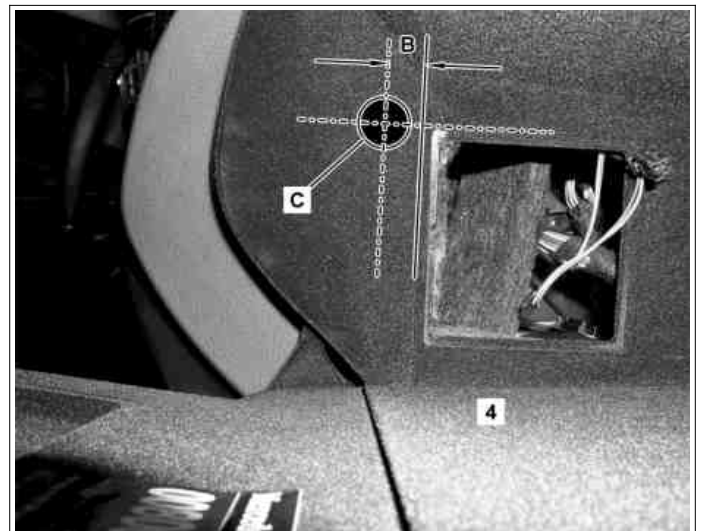

P82.60-5472-11

- 1 iPod wiring harness
- 2 iPod connector
- 5 Coupling for interface
- 6 Grommet

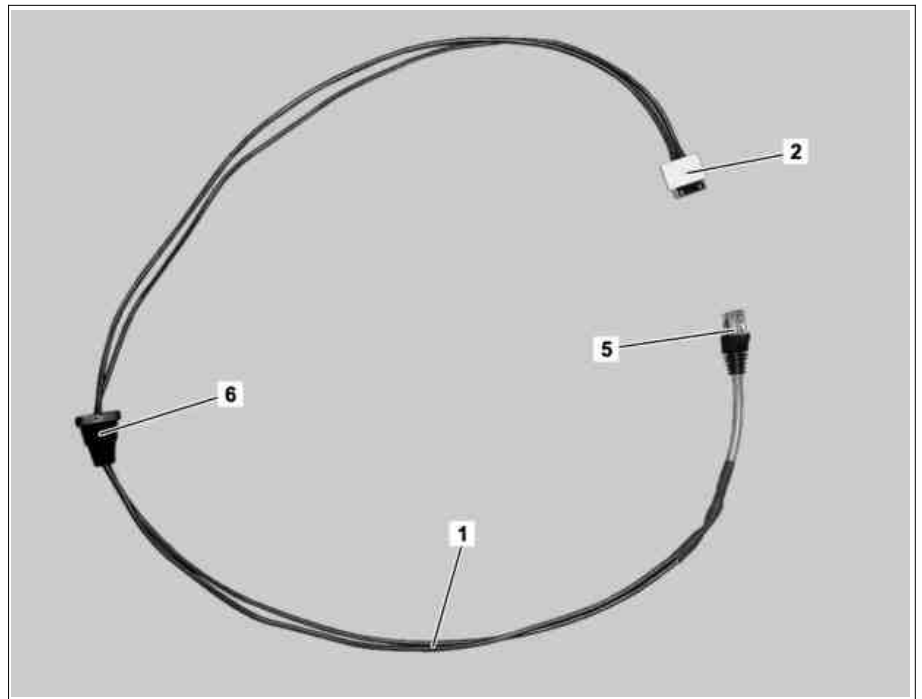

P82.60-4980-06



P82.60-5476-09

- 5 Route interface coupling (5) of iPod wiring harness (1) through drilled hole in glove compartment (4) into COMAND installation opening.
- 6 Seal hole with grommet (6).

- 7 Reinstall glove compartment lamp (E13/1) in glove compartment (4).

i The iPod coupling (2) is later connected to the iPod. The interface connector (5) can be connected to the iPod interface later.