## Noise in driver or front passenger seat when pressure applied to backrest

Topic number LI91.10-P-063385

Version 1

Design group 91.10 Front seats

Date 02-22-2016

Validity All model series driver or front passenger seats

Reason for change

## Complaint:

Creaking or grunting noise in seat when pressure applied to backrest.

## Cause:

Throughout the service life of the vehicle, tension may occur in the seat structure that generates noise.

## Remedy:

- 1. Unfasten the 4 bolts of the seat height adjuster from the body but do not remove them. The seat may not be removed!!
- 2. Fasten the seat height adjuster using the 4 bolts again and tighten to 50 Nm torque. (AR91.10-P-1000lf)

WIS-References			
Document number	Title	Note	Allocation
AR91.10-P-1000LF	Remove/install front seat	Front seat bolt torque	Remedy