Mercedes-Benz

CUSTOMER COLOR YEAR MAKE/MODEL

INVOICE Mercedes-Benz OF SAN ANTONIO 9600 SAN PEDRO-SAN ANTONIO, TEXAS 78216 PAGE 1 (210) 366-9601 www.mercedesbenzsanantonio.com SERVICE ADVISOR: MILEAGE IN/ OUT VIN LICENSE TAG SILVER 13 MERCEDES S550V 23023/23036 T3854 **DEL DATE** PROD. DATE WARR, EXP. **PROMISED** RATE PAYMENT INV. DATE PO NO. 02JAN14 DD18MAR13 01JAN201 :00 21FEB17 0.00 USED 22FEB17 R.O. OPENED READY OPTIONS: SOLD-STK TRN 15:09 17FEB17 14:52 22FEB17 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL A CUST STATES RATTLE IN LEFT FRT DOOR RELEASE HANDLE HIGHWAY DRIVING IF YOU PULL HANDLE OUT A LITTLE AND UP RATTLE WILL STOP CAUSE: LEFT FRONT DOOR LATCH RATTLING AGAINST DOOR 726405 INTERIOR DOOR PANEL OF FRONT DOOR REMOVE/INSTALL 6021 W08 (N/C)547989 UNSCREW/SCREW ON GROUND LINE OF ON-BOARD ELECTRICAL SYSTEM BATTERY (DURING REPAIR OPERATIONS) 6021 W08 (N/C)725851 1ST DOOR MODULE, LOCATION: REMOVE/INSTALL (WITH INSIDE DOOR PANEL REMOVED) 6021 W08 (N/C)941010 NOISES, LOCATION: LOCALIZE/RECTIFY FINDINGS: 6021 W08 CPZM BOOKER ZM APPORVAL FOR THIS LINE 6021 CP 0.00 0.00 LABOR: OTHER: 0.00 0.00 TOTAL LINE A: 0.00 23036 DOOR LATCH ASEMBLY RATTLING AGAINS DOOR. WO8. ROAD TEST (23036-23047) RATTLE INSIDE DRIVER DOOR ASSEMBLY While DRIVING, REMOVED DOOR PANEL AND ROAD TESTED (23047-23054) RATTLE STILL PRESENT INSIDE DOOR. REMOVED WINDOW REGULATOR, REMOVED DOOR LATCH ASSEMBLY. FOUND DOOR LATCH RATTLING AGAINST DOOR, INSTALLED FELT TAPE ON CONTACT POINTS, INSTALLED IN REVERSE ORDER, RATTLE NO LONGER PRESENT, ***************** B PROGRAM MBRACE FOR CUST HE HAS SUBSCRIBED MBRACE ACTIVATE EMBRACE SYSTEM. PUSH i- BUTTON TO VERIFY IF ACTIVATED (N/C). IF NOT ACTIVATED, PROCEED TO ACTIVATE. 1.0 HR. 6021 CP 130.00 130.00 PARTS: 0.00 LABOR: 130.00 OTHER: 0.00 TOTAL LINE B: 130.00 23036 ACTIVATED MBRACE AS REQUESTED 1.50 CP/INT.1.50 CONTACTED Notice Pursuant to Sec. 70.001, Texas Property Code
I am the person or agent acting on behalf of the person, who is obligated to pay for the repair of the motor vehicle subject to the repair contract. I understand that this vehicle is subject to repossession in accordance with Sec. 9.609, Texas Business and Commerce Code, if a written order for payment for repair on the vehicle is stopped, dishonored because of insufficient funds, no funds, or because the drawer or maker of the order has no account or the account on which it is drawn has been closed. DESCRIPTION TOTALS LABOR AMOUNT PARTS AMOUNT GAS, OIL, LUBE Signature of Person Responsible or Agent for Person Responsible I HEREBY AUTHORIZE THE FOLLOWING REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY MATERIAL AND HEREBY GRANT YOU AND/OR YOUR EMPLOYEES PERMISSION TO OPERATE THE CAR OR TRUCK HEREIN DESCRIBED ON STREETS, HIGHWAYS OR ELSEWHERE FOR THE PURPOSE OF TESTING, AND/OR INSPECTION. WE ARE NOT RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLES IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND OUR CONTROL. SUBLET AMOUNT MISC. CHARGES TOTAL CHARGES

"EXCEPT FOR WARRANTIES OF MERCEDES-BENZ USA, LLC, THERE ARE NO WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, ACCOMPANYING THE SALE OF ANY PARTS OR THE PROVIDING OF ANY SERVICE WORK PURSUANT TO THIS REPAIR ORDER AND MERCEDES-BENZ OF SAN SALES TAX ANTONIO EXPRESSLY DISCLAIMS THE SAME. PLEASE PAY CLIENT SIGNATURE X THIS AMOUNT

I ACKNOWLEDGE AND APPROVE ADDITIONAL WORK PERFORMED

LESS INSURANCE