

Noises from seat rail / seat fore/aft adjustment

Topic number	LI91.10-P-053443
Version	1
Design group	91.10 Front seats
Date	04-03-2012
Validity	Model series 221
Reason for change	Damage type added, model designations 221.095, 221.195 added

Complaint:

Tearing or creaking noises from the seat rail / seat fore/aft adjustment of the front seats. This complaint occurs especially on rough roads and when cornering.

Cause:

Contact between upper and lower rail at rear end of tunnel-side seat rail / seat fore/aft adjustment.

Insufficient lubrication of the door-side rail.

Remedy:

Regreasing of seat rail / seat fore/aft adjustment.

1) Move seat up and to the front (see Figure 1).

2) Use a brush to apply grease (A 002 989 07 51) to lower rail on tunnel side in the area shown (see Figure 2) and spread the grease film to the end of the seat rail (see Figure 3).

3) Thoroughly clean upper and lower areas (see Figure 4) of door-side rail and apply grease (A 002 989 07 51) with the aid of a brush.

In warmer regions use grease A 000 989 38 60.

Attachments	
File	Designation
Bild 1.JPG	Operation item
Bild 2.JPG	Area to be greased
Bild 3.JPG	Result
Bild 4.jpg	Door-side rail

Symptoms
Seat / Seat noises / Body / Cracking /

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC	Non-EPC
A0029890751			Grease	1	Order 125 ml container as required		X
A0009893860			Grease	1	Order 100 ml container as required	X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			91273 36	Seat fore/aft adjustment mounting