





DTB Date: January 9, 2009

Order No.: P-B-91.40/115a

Supersedes: P-B-91.40/115 dated Sept. 13, 2006

Group: 91

**Revision History** 

Revision Date Purpose

a 1/9/09 Applicable Models and Damge Code Updated

- 9/13/06 Initial issue

SUBJECT: Model 221.171/176/177/179/186 (with Option Code 223 or 223+224)

Rear Seat Belt Comfort Fit and/or Head Restraint Raising Mechanism Not

**Functioning When Fastening Seat Belt** 

If you receive customer reports in the above model vehicles of the rear seat belt comfort fit and/or head restraint raising mechanism not functioning when fastening seat belt, the wiring from the buckle may be damaged. To resolve, perform the following procedure.

- 1. Remove seat belt buckle. Refer to WIS document AR91.40-P-1516SX.
- 2. Secure the wiring on the replacement buckle using fabric tape as shown in (Figure 1).
- 3. Install in reverse order.

Note: The wiring has been secured in production from December 2005.

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

www.startekinfo.com



Figure 1 – Wiring secured with fabric tape P-B-91.40/115

Note: Verify part application in EPC by VIN)

## **Parts Information**

Qty. Part Name Part Nu			
1	Outside left seat belt buckle (with code 223 + 224, up to end of MY 2007)	A221 860 05 69 <sup>1</sup>	
1	Outside right seat belt buckle (with code 223 + 224, up to end of MY 2007)	A221 860 06 69 <sup>1</sup>	
1	Outside left seat belt buckle (with code 223 + 224, as of MY 2008)	A221 860 21 69 <sup>1</sup>	
1	Outside right seat belt buckle (with code 223 + 224, as of MY 2008)	A221 860 20 69 <sup>1</sup>	
1	Outside left seat belt buckle (with code 223, up to end of MY 2007)	A221 860 11 69 <sup>1</sup>	
1	Outside right seat belt buckle (with code 223, up to end of MY 2007)	A221 860 12 69 <sup>1</sup>	
1	Outside left seat belt buckle (with code 223, as of MY 2008)	A221 860 23 69 <sup>1</sup>	
1	Outside right seat belt buckle (with code 223, as of MY 2008)	A221 860 22 69 <sup>1</sup>	

<sup>&</sup>lt;sup>1</sup>Trim code required

Note: The following allowable labor operations should be used when submitting a warranty claim for this repair. This information has been generated on January 9, 2009. Please refer to Netstar → Star TekInfo → Star Time for the most current labor time allowance.

## In Case of Warranty

**Operation:** Buckle for seat belt on left rear seat, R&R/replace (91-1528)

Buckle for seat belt on right rear seat, R&R/replace (91-1531)

Seat belt wiring, secure (91-0000)

Damage Code	<b>Operation Number</b>	Time (hrs.)	Model Indicator (s)
92N53 73	91 1531	0.5 hrs.	AA, AB, AC, AD, AE
If necessary (up to 12/05 production):	91 0000	0.1 hrs. *	AA, AB, AC, AD, AE
Or:	_		-
92A53 73	91 1528	0.4 hrs.	AA, AB, AC, AD, AE
If necessary (up to 12/05 production):	91 0000	0.1 hrs. *	AA, AB, AC, AD, AE

<sup>\*</sup> Maximum time allowed with a separate time punch. Ensure that punches are labeled as NON time.