



DTB

Date: November 4, 2008
 Order No.: P-B-54.30/206
 Supersedes:
 Group: 54

**SUBJECT: Model 221.171/176/179 , Up to VIN A077729
 Equipped with Night View Assist (SA code 610)
 Night View Assist Picture Occasionally Not Displayed**

If you receive customer reports in the above model vehicles of no picture displaying in the driver display in the instrument cluster after Night View Assist has been activated, this may be due to a software error in the instrument cluster. To resolve, flash the instrument cluster with SDS version 03/2006 or higher via menu path: Control units → Information and Communication → Instrument Cluster → Control Unit Adaptations → Control Module Programming.



Note: During erroneous operation, the speed display will still be shown at the bottom edge, but the rest of the display will remain black.



Note: The following allowable labor operations should be used when submitting a warranty claim for this repair. This information has been generated on November 4, 2008. Please refer to Netstar → Star TekInfo → Star Time for the most current labor time allowance.

In Case of Warranty

Operation: Short test, perform (54-1011)
 Control unit – software (after short test), install (54-0991)

Damage Code	Operation Number	Time (hrs.)	Model Indicator (s)
54288 EA	54 1011	0.3 hrs.	AA, AB, AC
	54 0991	0.3 hrs.	AA, AB, AC

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.