



**DTB**

Date: January 21, 2009  
 Order No.: P-B-22.10/01d  
 Supersedes: P-B-22.10/01c dated October 23, 2008  
 Group: 22

**Revision History**

Revision	Date	Purpose
d	1/21/09	Damage Code Revised
c	10/23/08	Damage Code Revised
b	4/4/08	Warranty Information Updated
a	8/21/07	VIN Cut-off and WIS Document Reference Added
-	4/18/07	Initial issue

**SUBJECT: Model 221.186 (S Class 4-Matic), Up to VIN A127497**  
**Engine Humming / Vibrations between 1200 to 1600 RPM**

If you receive customer reports in the above model vehicles of humming/vibrations in the engine rpm range from 1200 to 1600 (clearly felt in the steering wheel and footwell floor), install optimized engine mounts which may resolve the humming / vibration condition. Refer to WIS document AR22.10-P-1260SW.

**i Note:** Insure that the engine mounts are seated flat on the engine support.

**Parts Information**

Qty.	Part Name	Part Number
2	Front engine mount	A221 240 08 17

**i Note:** The following allowable labor operations should be used when submitting a warranty claim for this repair. This information has been generated on January 21, 2009. Please refer to Netstar → Star TekInfo → Star Time for the most current labor time allowance.

**In Case of Warranty**

**Operation:** Engine compartment panels – bottom (all), R&R (61-1069)  
 Front engine mounts – left and right side, replace (22-1260)

Damage Code	Operation Number	Time (hrs.)	Model Indicator (s)
24N01 36 (right)	61 1069	0.4 hrs.	AD
24A01 36 (left)	22 1260	4.7 hrs.	AD

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.