

Service Campaign Bulletin

FILE: SERVICE: GROUP 00 OF SERVICE INFORMATION BINDER
PARTS: GROUP I OF INFORMATION _ PARTS & ACCESSORIES BINDER

Campaign No. 2008120002, January 2009

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Models 216 and 221, Model Year 2009**
Replace Engine Compartment Prefuse Box

This Service Campaign has been initiated because Daimler AG has determined that due to thermal expansion damage may occur within the engine compartment prefuse . If the metal strip is damaged the battery can no longer be charged. The engine compartment prefuse box will be replaced at the next workshop visit.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall and Service Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 4,130 vehicles are affected.

Order No. P-SC-2008120002

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

1. Replace engine compartment prefuse box, refer to WIS: AR54.15-P-1330SY.

Note:

Tabs on cable ends are keyed to prefuse box. When securing cable ends to prefuse box terminals, ensure tabs on cable ends match cutouts in prefusebox.

2. Connect Star Diagnosis, readout and erase fault memory.

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Engine compartment prefuse box	A 221 540 26 50 05	100%

Note:

- Please be aware that only the part number(s) referenced in the Campaign Bulletin is/are approved for use to repair the vehicle. Repairs performed using any other part(s) will not have been performed in accordance with the campaign. Accordingly, warranty claims submitted with reference to an improper part number(s) will be denied.
- The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Replace engine compartment prefuse box (02-6235)
Connect/disconnect Star Diagnosis System (02-4762)
Read-out and erase fault memory (02-5059)

Damage Code	Operation Number	Labor Time (hrs.)	Model Indicator(s)
54 930 33 7	02-6235	0.6	AA, AB, AC, AD, AE, DB, DC, DD, DE
	02-4762	0.2	
	02-5059	0.1	