



Mercedes-Benz

Campaign No. 2018010009, March 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Models 222, 166, and 292 Model Years 2017 and 2018**
Check Left Door Locks, Replace if Necessary

Daimler AG ('DAG'), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY17-18 S-Class, GLE-Class, and GLE-Coupe Class vehicles (222, 166, 292 platform), the left rear door lock may indicate a locked position when the door is not locked. If the interior or external door handle of the left rear door of the vehicle is operated while the door lock is in the locked position, the door may still open. As such, the vehicle may not meet Federal Motor Vehicle Safety Standard 206. An authorized Mercedes-Benz dealer will check the left rear door lock on the affected vehicles and replace them, if necessary.

Prior to performing this Recall Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 8700 vehicles are involved.

Order No. P-RC-2018010009

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Check / Test

1. Open left rear door, pull on the inside door handle of the rear door. At the same time, lock and unlock the vehicle five times using the remote control.



Figure 1

2. Close the left rear door and lock the vehicle completely using the remote control.
3. On the locked vehicle, pull on the left rear door's outside door handle.
 - a. If the door on a locked vehicle can be opened: Carry out **work procedure**.
 - b. If the door on a locked vehicle **cannot** be opened: **End measure**.

i The **findings** from the check/test procedure must be recorded **in writing in the work order**.

Procedure

1. **Replace left rear door lock.**

i For basic data for model **222**, see **AR72.12-P-2510LFS**

i For basic data for model **166** and **292**, see **AR72.12-P-2510GQ**

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
As required	Left Rear Door lock	*	1%

* Determine part number for door lock in EPC using the vehicle identification number.

**Warranty Information
With Check**

Operation: Check left door lock (02-2209)

Damage Code	Operation Number	Labor Time (hrs.)
72 910 49 8	02-2209	0.1

With Check and Repair

Operation: Check left door lock (02-2209)
Replace Rear left door lock, model: 222, 292, and 166 (02-2211)

Damage Code	Operation Number	Labor Time (hrs.)
72 910 49 7	02-2209	0.1
	02-2211(292, 166)	1.2
	02-2211(222)	1.1

**Note**

Operation Number labor times are subject to change.