

Rear seat belts roll up with difficulty

Topic number	LI91.40-P-059554
Version	1
Design group	91.40 Seat belts, emergency tensioning retractors
Date	07-31-2014
Validity	Model series 222 (CODE: 223)
Reason for change	

Complaint:

The left or right rear seat belt does not roll up correctly

Attachments	
File	Description
Photo_1.JPG	Fault profile

Cause:

The retractor housing collides with the reel flange causing increased friction. This obstructs the retraction of the belt.

Remedy:

If this complaint occurs, always replace both rear seat belts (on the outside).

Some parts may be non-stocking parts for MBUSA, and possibly C66 and not immediately available from DAG. Please be aware and check availability prior to scheduling customer repairs!

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 222 860 43 85			Left rear seat belts	1		X	
A 222 860 20 85			Right rear seat belts	1		X	
A 222 860 44 85			Right rear seat belts	1		X	
A 222 860 19 85			Left rear seat belts	1		X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			92A52 52	Does not operate correctly
			92N52 52	Does not operate correctly

WIS-References

Document number	Title	Note	Allocation
AR91.40-P-0681LFA	Remove/install seat belts in rear		Remedy