
Operation of head unit via touchpad (A105) not possible

Topic number	LI82.60-P-059737
Version	1
Design group	82.60 Radio, audio/video systems
Date	08-27-2014
Validity	BR205 with code 522 or code 531 BR222 with code 805 and code 448 BR217 with code 805 and code 448
Reason for change	New remedy Validity adapted

Complaint:

The head unit cannot be operated using the touchpad (A105).

The touchpad (A105) does not respond to any touches or does so only sporadically.

Cause:

Currently being analyzed

Remedy:

Please perform the following steps:

1. Update software of touchpad control unit (A105):

-> Control units view

-> Information and communications

-> Touchpad (A105)

-> Adaptations

-> Control unit programming

2. Perform calibration of touch-sensitive surface:

-> Control units view

-> Information and communications

-> Touchpad (A105)

-> Actuators

-> Calibration of touch-sensitive surface of component

Notes:

- For Xentry DVD 05/2014 the add-on 3862 is required.
- For Xentry DVD 07/2014 the add-on 3863 is required.
- During calibration do not place your fingers or any objects on the surface of the touchpad.
- If the fault is still present after calibration, the touchpad must be replaced.

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma-ke part
A 205 900 68 16			Touchpad control unit	1	For BR205	X	
A 222 900 88 10			Touchpad control unit	1	For BR222 and BR217	X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
54-3033	REMOVE/INSTALL TOUCHPAD	11AW	8271R E9	
54-0991	CONTROL UNIT: TOUCHPAD (A105): INSTALL SOFTWARE	4AW	8271R E9	